

# ADAPT-A-LIFT GROUP PTY LTD

## Service History Listing Active Units

Date: 17/05/2023

Time: 11:12:27AM

For Equipment Code From: H11899 To: H11899

For Customer Code From: All To: All

For Date Posted From: All To: All

For Branch Code From: All To: All

Don't Show Cost

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner: ADAP001</b>							
	<b>Equip. Code: H11899</b>						
	<b>Description: HYSTER W25ZA2</b>						
	<b>Make: HYSTER</b>						
		<b>Model: W25ZA2</b>			<b>Serial No.: B495N02193L</b>		
1466528	Scheduled Service - PG 500hr Service .0500 Hour Service	PGibson	21/07/2022	Internal	686.0	\$0.00	Carry out 500hr Service Take photos of unit Send in Audit Form.
							Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
							Grease All Points on Unit,
							Carried out 500hr Service. Photos taken of unit. Sent in Audit Form.
1457968	Carry out Test & Tag on Charger	ALarive	10/06/2022	Internal	686.0	\$0.00	Battery is fully charged. Carry out Test and Tag on Charger. Take photos of new label and unit. Send in Audit Form.
							Test and Tag
							Carried out test and tag on unit Completed audit form
1454504	500 hour servive 0500 Hour Service	301WORKSHOP	27/05/2022	Internal	686.0	\$0.00	

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER		<b>Model:</b> W25ZA2		<b>Serial No.:</b> B495N02193L		
1454498	Check drive wheel	ALarive	27/05/2022	Internal	686.0	\$0.00	<p>check drive wheel condition fill in Audit form take photos with tablet</p> <p>Carry out Inspection and Diagnosis of Wheel</p> <p>Remove ancillary items and Remove Drive Wheel from unit,</p> <p>Refit Drive Wheel, Refit ancillary items,</p> <p>Inspected drive wheel condition Removed trims and covers, jacked up unit and removed drive wheel from hub Checked wheel with supplied wheel and found too widee, hitting frame and would not go on Re-fitted wheel and trims - right wheel to be ordered.</p>
1423428	Check battery leaking fluid	ASAVENCU	4/01/2022	Internal	686.0	\$0.00	<p>Remove battery check for fluid leaks take photos with tablet</p> <p>Steam clean equipment as necessary.</p> <p>Prepare For Hire - Workshop</p> <p>battery removed and checked for fluid leaks found leaking and cleaned up acid steam clean photos taken</p>
1423363	Paint red strip on top of mast or load gaurd	ASAVENCU	31/12/2021	Internal	686.0	\$0.00	<p>Paint red strip on top of mast or load gaurd take photos with tablet</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>top of mast painted in red photos taken</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2			<b>Serial No.:</b> B495N02193L		
1421114	STR inspection due	PGibson	15/12/2021	Internal	686.0	\$0.00	<p>Carry out STR inspection due</p> <p>ensure unit has operators manual</p> <p>ensure unit has has battaery fully charged</p> <p>ensure unit is rental ready</p> <p>touch up paint work</p> <p>fill in Audit form</p> <p>take photos with tablet</p> <p>Remove ancillary items, prepare and Paint unit as required,</p> <p>Steam clean equipment as necessary.</p> <p>Prepare For Hire - Workshop</p> <p>Replace Load Wheel/s,</p> <p>Carried out STR Inspection.</p> <p>Operator manual is missing and box is broken. 4 week wait on parts.</p> <p>Battery has now been fully charged.</p> <p>Rental Ready Tag is attached.</p> <p>Tynes and body painted red and yellow.</p> <p>Audit form filled in.</p> <p>Greased unit. Lubed chains.</p> <p>Photos taken.</p> <p>Load wheels were replaced.</p> <p>Rubber strip was replaced(torn in three pieces).</p> <p>Stickers added.</p> <p>Steam cleaned unit.</p>
1416868	De hire inspection due	ACUNNINGHAM	25/11/2021	Internal	686.0	\$0.00	<p>Carry out De hire ionspection</p> <p>document any further work required for Authorisation</p> <p>take photos with tablet</p> <p>Carry out equipment condition assessment</p> <p>Carried inspection</p> <p>Unit not operational.</p> <p>Tiller Head &amp; loom missing</p> <p>Load wheels cracked</p> <p>Rubber strip damaged</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2		<b>Serial No.:</b> B495N02193L			
1414439	UNIT IS IN SPRIGNVALE Diagnose unit- not running	ALarive	15/11/2021	Internal	686.0	\$0.00	<p>Travel to site, Carry out Inspection and Diagnosis of Attachment Carried out diagnostics as per previous job (1412825, images on job) Removed covers, checked wiring and proxy sensor. Found unit to be tripping out when any button pressed. Possible failure in circuit board in function assy as horn does not work either. Parts ordered - switches assy, horn, yellow buttons, circuit board (4014695), proxy sensor **took time to locate part on hyster (35mins)** Arrived on site to carry out further work. Found unit has been picked up by tow truck (de-hire) Parts ordered (in van) but unable to carry out work and further diagnostics.</p> <p>Replace Main Electrical Panel,</p> <p>Arrived at workshop and located unit. Removed all old possibly faulty parts and replaced circuit board, switches, proxy sensor. Re-fitted to handle but unable to test as battery voltage low and requires charging.</p> <p>Labour</p> <p>Load software as required to calibrate the unit,</p> <p>Found unit still not working - was advised by other tech circuit board requires programming. Located service manual and trouble shooting procedures Followed steps to re-calibrate circuit board. Tested unit - all ok</p> <p>Carry out Inspection and Diagnosis of Electrical System</p> <p>Assist Andrew with diagnosis of unit, rectification &amp; calibrations of controllers.</p> <p>Found unit required calibration with new circuit board as unit would not operate Calibrated unit with another tech and ran diagnostics. Unit would not go fast in reverse. Hooked up Zapi controller to fault find. Re-calibrated unit and tested operation - all ok</p>

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER		<b>Model:</b> W25ZA2		<b>Serial No.:</b> B495N02193L		
1412825	on site dehire inspection TRANSPORT BOOKED FOR FRIDAY 12/11	ALarive	5/11/2021	Internal	686.0	\$0.00	Travel to site, Prepare For Hire - Field Carry out Inspection and Diagnosis of Attachment Carried out de-hire inspection and found unit will not move. Inspected unit and removed covers and checked wiring and proxy sensor. Found unit to be tripping out when any button pressed. Possible failure of circuit board in function assy as horn does not work either. Spoke to chris and will get training.
1395083	730 25.10.21 Scheduled Service - 4000hr SM - 4000hrs .4000 Hour Service	BTHau	23/08/2021	Internal	682.0	\$0.00	Bottom rubber guard split/torn, paint scratches. **new job raised for diagnosing unit -1414439** 250hr Service unit currently not on site.  Travel to site, 4000hr Service, Grease All Points on Unit,
1351772	Horn not working. SF EMAIL	dslinger	3/02/2021	Internal	476.0	\$0.00	Travel to site,  Carry out Inspection and Diagnosis of Attachment  travelled to site ,located unit ,tested power supply to horn ,got horn to operate but requires new horn ,have contacted spares ,dave  Labour  Replace Horn  located unit ,fitted new horn to unit ,tested operation ok ,dae

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2			<b>Serial No.:</b> B495N02193L		
1350616	Scheduled Service - 0500 Hour Service .0500 Hour Service	dslinger	28/01/2021	Internal	478.0	\$0.00	Travel to site,  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Adjust Lift Chain to correct specification,
1339877	Unit wont raise. when tried to raise , the horn goes off. SF Email.	dslinger	12/11/2020	Internal	470.0	\$0.00	travelled to site ,carried out scheduled service ,adjusted lift chains ,horn not working ,parts are ordered ,dave Travel to site,  Carry out Inspection and Diagnosis of Attachment  travelled to site via drop point ,waited for unit ,unit operating correctly ,unit horn will sound when battery is 70 % discharged ,unit is fully charged atm and operating correctly dave
1327441	Replace BDI Display Tiller Pivot Pin & RHS Tyne Knob	dslinger	16/09/2020	External	470.0	\$952.72	Labour  Travel to site,  Replace Battery Discharge Indicator as required,  Repair Forks/Tynes as necessary,  Remove ancillary items and Repair Frame, Body or Chassis as necessary, Refit ancillary items,  Repair Steering Column as required,  picked up parts from workshop ,travelled to site ,carried out repairs ,roll pin was not supplied with tyne knob ,substituted with split pin ,checked operation and display repaired thread on frame for tiller pivot bolts ,fit new pivots ,dave

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2			<b>Serial No.:</b> B495N02193L		
1315947	Scheduled Service - AUG 0500 Hour Service - Need to book in with customer .0500 Hour Service	GGULFAN	1/08/2020	Internal	462.0	\$0.00	Carry out equipment condition assessment Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements. take time wait for unit still in operation. moved unit to safe working area. performed preventive maintenance schedule at 500 hours interval. removed ancillary covers. blown out and cleaned unit. grease all points and lubricate the unit. carry out safety inspection of unit. *Problem found Tiller Pivot Pin missing need to replace and RHS Tyne knob missing need to replace. Note: Customer damage BDI display crack, need to replace. refit ancillary covers. test ran unit. unit is operational. glen
1276057	Scheduled Service - Must do a 2000hrs service Must do a 2000hrs service. 2000 Hour Service	IFRUGAL	21/02/2020	Internal	386.0	\$0.00	Carry out equipment condition assessment  2000hr Service  Remove ancillary items and Repair Wiring as necessary, Refit ancillary items,  (386) 2000 hours servicing Inspection of unit and lubrication of mast and steering bearing. Waiting for unit. Repair horn not working Install all covers.(ian) 1000hr Service
1216721	Scheduled Service - 1000 Hour Service (HBW2530ZA1). 1000 Hour Service	LMASUNDA	10/06/2019	Internal	360.0	\$0.00	1000HR service performed, all seems ok. Button on tiller handle damaged (see images).
1208269	Horn is not working - still in use.	LMASUNDA	15/05/2019	Internal	360.0	\$0.00	Horn is not working - still in use.  Carry out Inspection and Diagnosis of Electrical System  Inspected wiring and checked horn, tested and horn works. Could not find or fault horn.
1200961	Unit is not charging - Anthony Davis 0420 373 108	MPAULUSZ	12/04/2019	Internal	1234.0	\$0.00	Unit is not charging - Anthony Davis 0420 373 108  Travel to site,  Repair Traction Battery  Got to site and could not get a permit to work.  Carry out Inspection and Diagnosis of Electrical System  Same problem as previous job

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2						
				<b>Serial No.:</b> B495N02193L			
1120887	Scheduled Service Level B Service	LMASUNDA	15/06/2018	Internal	328.0	\$0.00	Scheduled Service  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1068644	500hr BE Scheduled Service -	LMASUNDA	30/11/2017	Internal	304.0	\$0.00	Site too busy to give up unit. As unit is the only one on site used in the area it is in. However unit can be serviced Thursday or Friday.  Travel to site,  Service performed. Lift button missing, see images. 500hr BE Scheduled Service -
1027438	Scheduled Service -	LMASUNDA	29/06/2017	Internal	48.0	\$0.00	Travel to site,  Spoke to Julie and site is too busy. Entrance is blocked by trucks waiting to go into site.  Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.  Unit is currently in use and can not be given up for service.  Service performed, all seems ok. Scheduled Service -
1023191	Scheduled Service Job. Level B Service		17/05/2017	Internal	113.0	\$0.00	Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
1018656	Scheduled Service Job. Level B Service		17/05/2017	Internal	113.0	\$0.00	Service performed.
971295	Scheduled Service - Forkone	301SUBC	15/11/2016	Internal	113.0	\$0.00	Scheduled Service - Forkone
920178	Scheduled Service - - Forkone to attend	301SUBC	18/05/2016	Internal	113.0	\$0.00	Scheduled Service - - Forkone to attend
	John - 5945 3341						John - 5945 3341
							Travel to site, locate unit, carry out PM, grease & lube unit, inspect chains and tyres.

Job No.	Description	Mechanic	Date	Job Type	Eng. Hrs	Retail	Notes
<b>Owner:</b> ADAP001							
<b>Equip. Code:</b> H11899	<b>Description:</b> HYSTER W25ZA2						
	<b>Make:</b> HYSTER	<b>Model:</b> W25ZA2		<b>Serial No.:</b> B495N02193L			
860281	Scheduled Service -	301SUBC	7/10/2015	Internal	113.0	\$0.00	Scheduled Service -
							TRAVEL TO SITE. LOCATE UNIT. CARRY OUT PM SERVICE. GREASE AND LUBE UNIT.
819885	QUOTE - FIT RUBBER FOOT PROTECTOR	301QUOTE	7/05/2015	External	0.0	\$0.00	
811701	Scheduled Service -	RSZABO	7/04/2015	Internal	59.0	\$0.00	Scheduled Service -
							Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
755294	scheduled service	LMASUNDA	25/08/2014	Internal	1.0	\$0.00	Located unit,Carried out Scheduled Service. scheduled service
							Carry out preventative maintenance service and safety inspection in line with the agreed scope of work. Report on condition of equipment and additional work requirements.
746744	Prep For Rental - Simplot, Pakenham	301WORKSHOP	24/07/2014	Cap Prep	0.0	\$0.00	Labour Hours: 2.0
							Install new Drive Wheel (see Amy)
				<b>Equipment Total:</b>	<b>\$952.72</b>		
				<b>Customer Total:</b>	<b>\$952.72</b>		