

## Finished Date/Tim Description

- 6/11/2023 replace worn mats and seats  
165,000 km service - Gb Auto  
21/09/23 - Carry out 165,000 km service. Replaced engine oil. Replaced oil, air, fuel and cabin filters.  
Replaced front & rear diff oils. Remove &  
clean mass air flow sensor. Drain, fill & bleed cooling system. Replaced wipers. Inspected vehicle. Checked  
& adjusted fluids. Wash engine. Road
- 26/09/2023 test - ok.  
GB Auto Gunnedah  
Toyota Hilux #UF65 Rego: DWR28P KM: 159,297  
Glove box replacement  
17/08/23 - Replace glovebox & lock mechanism. Replaced left hand rear parker globe & number plate
- 22/08/2023 globe. Test - ok.  
GB Auto  
  
Toyota Hilux #UF65 Rego: DWR28P KM: 159,297  
Rego Inspection
- 21/08/2023 17/08/23 - Carry out rego inspection. Fail now Pass. E-Safety #AS0537896  
  
GB Auto Gunnedah  
150,000 km service  
04/08/23 - Carry out 150,000 km service. Replaced engine oil. Replaced oil, air, fuel and cabin filters.  
Remove & clean mass air flow sensor.  
Replaced wipers. Inspected vehicle. Checked & adjusted fluids. Adjusted rear brake & handbrake. Change  
passenger side H4 globe. Inspect glove  
box. Found glove box requires replacement. Road test - ok.
- 8/08/2023 Inspect vehicle for no parkers in minebar. Trace wiring and found break. Repair wiring, Test - ok.  
UF65 140,000km service, fix glove box and head light  
  
140,000km log book service  
Air filter, Cabin filter, Rotate tyres, Transfer case oil, Right hand low/high beam globe, Re attach drivers  
seat trim, Repair glove box door (U/S) requires new door
- 19/05/2023 Road test

Replace 4 tyres and wheel alignment - Tyrepower  
 27/02/2023 Toyo 265/65R17 120R OPEN COUNTRY AT2  
 Repairs required as part of 135000km service - Aztech  
 Adjusted hand brake  
 Replaced Rh bullbar light as inop  
 27/02/2023 Carried out road test  
 135,000km service - Aztech  
 Carried out 135,000km service  
 First Aid: no first aid kit  
 27/02/2023 Fire extinguisher: needs to be replaced  
  
 120,000 km service - GB Auto  
 Replace oil, air, fuel & pollen filters. Adjust rear brakes & handbrake. Drain & replace front & rear diff oils.  
 Replace brake fluid. Replace brake fluid. Replace wiper blades. Remove & clean mass air flow sensor.  
 Remove L & R front CV joint shafts to clean  
 dirt build up from flange & grease. Fit new CV joint to L/H side as nit picked up on thread & damaged  
 beyond repair. Remove L & R rear  
 mudguards, fuel neck filler & tray mounting bracket to remove 2 x L & R front tray securing bolts & nuts.  
 Fit new bolts, nuts & washers. Assemble.  
 7/12/2022 Wash engine. Road test.  
 No start - GB Auto  
  
 27/09/22 - Inspect vehicle for possible start fault and found starter failed. Roll start and bring back to GB  
 yard to  
 replace.  
 21/10/2022 28/09/22 - Change out starter motor. Tested ok.  
 Replace 2 tyres - Tyrepower  
 4/10/2022 Toyo 265/65R17 120R OPEN COUNTRY AT2  
  
 110000km service - GB Auto  
 Carry out 110,000 km service. Replace oil, air, pollen & fuel filters. Adjust rear brakes. R & R rear wheels.  
 Mine bar mounts damaged/broken off. Remove bar & locate new mounting points. Drill out on  
 headboard & refit mine  
 4/10/2022 bar. All secure & wiring

18/08/2022 clean battery terminals  
Replace Seat Covers

18/08/2022 Replace reflective tape  
100000km service - GB Auto  
16/08/22 - Carry out 100,000 km service. Replace oil, air, fuel & pollen filters. Adjust rear brakes & handbrake. Captive nut insert bash plate thread as it was damaged. Replace wiper blades. Fire extinguisher last inspected June 2022.

16/08/2022 Wash. Road test.  
Replaced Fire Extinguisher  
New - FE367

14/07/2022 Old - FE350  
Replace both sets of mudguards

27/07/2022 90,000KM Service & Defects  
90,000 km service & defects - GB Auto  
30/06/22 - Carry out 90,000 km service. Replace oil, air, fuel & pollen filters. Replace oil, air, fuel & pollen filters. Adjust brake & handbrake. Remove & clean mass air flow sensor. Replace wiper blades. Replace blown R/H brake globe.  
Remove old mudguards. Fit & mount new guards & flaps (supplied by customer). Road test. Mount & wire up reverse

30/06/2022 buzzer as original was missing.  
Repairs required as part of 80,000km Service - Completed by Aztech Inv 20649

- Replaced air & cabin filter as u/s  
- Replaced front brake pads

24/02/2022 - Replaced beacon  
80,000km Service - Completed by Aztech INV20648  
Carried out 80,000km service  
- Adjust hand brake

28/02/2022 - Carried out road test

1/03/2022 Remove and Replace door, bonnet and tailgate ID's - stickers provided by Sign Print Stich INV 15258

17/11/2021

- Carried out 70,000km service

30/11/2021 - Adjust handbrake

- Replaced air, cabin & fuel filter

- Replaced windscreen wiper blades

17/11/2021 INV-19438

18/11/2021 4 x New tyres

20/05/2021 replace 2 x door ID, 1 x bonnet ID

7/04/2021 supply bonnet and door decals

26/03/2021 60,000km service

UF65 - Work Performed Inspection and repairs to wiring and mount of lightbar.

Found relay for reverse buzzer faulty. REplace and

16/06/2020 tighten mount