

CUSTOMER COPY

Service Tax Invoice

		Date: 27/05/2	024 Inv	valce No: E29106	
Customer Details		Reg No.	Stock No.	Advisor	Tag Number
		387	T32319	SAIYAD HUSSEIN	
		Current Kims	Body No.	Wty Start Date	Why Expiry Date
	-	8106			
		Vehicle Identification N	umber	Build Date	Compliance Date
		YY07-28387		01/16	
Contact No. Today	Contact Today	Engine Number		Selling Dealer	Delivery Date
0487 628 206	ASDS CIVIL				
Driver Name	Driver Phone	Driver Email Address		Radio/DVD Code	Order No.
CCard No.	Home No.	Vehicle Description			Body Type
44217		DEFAULT			SK136SR-3
Mobile No.	Work No.	Model	Colour	Sale Kims	Ext Why Type
0487 628 206		KOBELCO SK135SR-3	BLUE GREEN		
Email Address		Booked	Required	Ext Why Exp Date	Ext Why Exp KM
asdscivii@gmail.com		23/05/2024 07:00AM	23/05/2024 11:00AM		
WTYP JOB DESCRIPTI	ON				
1/R EXHAUST SYS	STEM (EXH)				

Complaint: DIAGNOSE & REPORT ON DPF FAULT CARRIED OUT DPF DELETE REMOVED AND REPLACED DPF WITH CLEANED OUT DPF REMOVED ECU SENT

TO GET RESET ONCE DONE REFITTED TO MACHINE CLEARED ALL CODES AND RESET SYSTEM TESTED ALL

Labour

EXHAUST SYSTEM (EXH)

Sundry 1.00 x WORKSHOP CONSUMABLES (MISC)

1.00 x ENVIROMENTAL LEVY (EL)

2/R TRAVEL TO SITE WHEN LEAVING SITE NO DIRT ON ROAD. (TRV)

Complaint (DEVCON SITE) STUART RD, KATOOMBA SITE CONTACT: 0487 628 206

(DEVCON SITE) STUART RD, KATOOMBA

SITE CONTACT: 0487 628 206

Labour TRAVEL TO SITE WHEN LEAVING SITE NO DIRT ON ROAD. (TRV)

3 / R ENGINES (ENG)

Complaint CHECK AND RECTIFY ENGINE LOOSING POWER

CHECKED FOR ENGINE LOOSING POWER CHECKED AND FOUND BLOWN TURBO REMOVE AND REPLACED TURBO WITH SECOND HAND TURBOINO WARRANTY FOR TURBOJRESET SYSTEM CHECKED OPERATION ALL

OKAY

Labour

ENGINES (ENG)

Additional Products

SL1119 DPF DELETE TO SK135-3 ECU

Printed by SAIYAD HUSSEIN on 27/05/2024 02:40:58PM

Amount (ex GST) \$2100.00 2100.00

Amount (ex GST)

Amount (ex GST)

Amount (ex GST)

23.50

\$557.90

150.00

\$150.00

400.00

\$400.00

Continued Over. Page 1 of 2

Invoice No. E29106

Total Costs Total Invoice (excluding GST) \$3207.90

Total Goods And Services Tax \$320.79 Total Round Off

\$3528.70 Total Invoice (including GST) Amount Due

\$0.01

3528.70

How to pay: Direct Deposit

Payment Details SubAcct

1571

Subjet Ŕ

CUSTOMER COPY ASDS CIVIL Reg No: 387

Ref No.

E29106

27/05/2024

CASH

Lube Service Completed: Grouped by Equipment

Equip Num From: 1-PL262 To: 1-PL262 AND Sort By: Equip Number

#	Equip Num	Lube/Service Type	Miles/km on Equip	Hours on Equip	Accomplished By	Date
1	1-PL262	-				
		500 Hour Service		2472	Gato Repairs	22/10/218
		1Kg Fire Ext-Replacement		3732	Paul Gosper	1/01/2017
		500 Hour Service		10	Gato Repairs	18/01/2017
		500 Hour Service		103	Gato Repairs	7/02/2017
		500 Hour Service		362	Gato Repairs	22/05/2017
		G22-Inspection-Pryor		442	Greg Pryor	5/06/2017
		500 Hour Service		892	Gato Repairs	3/10/2017
		1Kg Fire Ext-Annual		1200	DOO	1/12/2017
		9Kg Fire Ext-Annual		1200	DOO	1/12/2017
		Compliance Manual Update		1215	PRY	20/12/2017
		G22-Inspection-RMS		1224	Andrew Bowe	21/12/2017
		G22-Inspection-Pryor		1224	Andrew Bowe	21/12/2017
		500 Hour Service		1537	Gato Repairs	9/03/2018
		9Kg Fire Ext-Replacement		3732	Paul Gosper	1/06/2018
		500 Hour Service		2143	Gato Repairs	28/07/2018
		500 Hour Service		2472	Gato Repairs	22/10/2018
		Compliance Manual Update		2889	Greg Pryor	8/02/2019
		9Kg Fire Ext-Annual		2889	Leary	8/02/2019
		1Kg Fire Ext-Annual		2889	Leary	8/02/2019
		G22-Inspection-Pryor		2894	Greg Pryor	11/02/2019
		G22-Inspection-RMS		2894	RMS Andrew Bowe	11/02/2019
		500 Hour Service		3073	Gato Repairs	28/03/2019
		9Kg Fire Ext-Annual		3732	Paul Gosper	1/11/2019
		1Kg Fire Ext-Annual		3732	Paul Gosper	1/11/2019
		Compliance Manual Update		3763	Greg Pryor	7/11/2019
		500 Hour Service		3838	DMM-Jake	21/11/2019
		Compliance Manual Update		3838	Greg Pryor	21/11/2019
		Compliance Manual Update			Gosper	11/02/2020
		G22-Inspection-Pryor			Greg Pryor	11/02/2020
		G22-Inspection-RMS			Andrew Bowe	11/02/2020

Lube Service Completed: Grouped by Equipment

Equip Num From: 1-PL262 To: 1-PL262 AND Sort By: Equip Number

#	Equip Num	Lube/Service Type	Miles/km on Equip	Hours on Equip	Accomplished By	Date
1	1-PL262					
		500 Hour Service		4285	Gato Repairs	18/05/2020
		500 Hour Service		4766	Gato Repairs	16/11/2020
		1Kg Fire Ext-Annual		4961	Jason Leary	10/02/2021
		9Kg Fire Ext-Annual		4964	Jason Leary	11/02/2021
		Compliance Manual Update		4964	Greg Pryor	11/02/2021
		G22-Inspection-RMS		4989	TfNSW-David Williams	17/02/2021
		G22-Inspection-Pryor		4989	Greg Pryor	17/02/2021
		500 Hour Service		5251	Gato Repairs	15/06/2021
		1Kg Fire Ext-Replacement		5943	CAM	1/09/2021
		9Kg Fire Ext-Replacement		5943	CAM	1/01/2022
		500 Hour Service		5863	Gato Repairs	2/02/2022
		1Kg Fire Ext-Annual		5943	CAM	18/02/2022
		9Kg Fire Ext-Annual		5943	CAM	18/02/2022
		G22-Inspection-Pryor		5943	Greg Pryor	18/02/2022
		G22-Inspection-RMS		6055	David Williams	28/03/2022
		500 Hour Service		6512	Gato Repairs	12/07/2022

#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262					
		CAM-Machine delivered	18/01/2017		10	\$0.00
		013208-CAM/Gato Repairs-Fault code 20151- Fuel pressure issue,carried DPF regeneration	1/02/2017		67	\$0.00
		013210-Gato Repairs-Reset error code 20151	2/02/2017		85	\$0.00
		23/01/17-31Hrs-013204-31/01/17-013207- 57Hrs-CAM-Grease lines keep coming off 02/02/17-013210-85Hrs-CAM/Gato Repairs- Repaired grease line fittings	2/02/2017		85	\$0.00
		013212-CAM/Gato Repairs-50 Hour Service & inspect error code	7/02/2017		103	\$0.00
		013214-CAM/Gato Repairs-Replaced common rail fuel relief valve	9/02/2017		118	\$0.00
		Gato Repairs-Floated to Gato workshop-CCV kit and turbo update completed	21/02/2017		140	\$0.00
		013220-CAM/Gato Repairs-Error code 01028- Repaired turbo hose and hydraulic leak on pump on intake	24/02/2017		166	\$0.00
		013233-Gato Repairs-Software upgrade & CCV Mod carried out.New seat cover fitted	3/04/2017		255	\$0.00
		013240-CAM/Gato Repairs-Seat cover has been installed	20/04/2017		290	\$0.00
		09/05/17-013247-342 Hours-CAM-Engine Fumes are constant all the time 22/05/17-Gato Repairs-Replaced engine under warranty	22/05/2017		362	\$0.00
		19/05/17-359Hrs-Gato Repairs-Last weeks engine modification failed and filled turbo with engine oil 22/05/17 Gato Repairs-Replaced engine under warranty	22/05/2017		362	\$0.00
		Gato Repairs-Fitted new engine after destroying the original with a bad modification	22/05/2017		362	\$0.00
		G22 Inspection-G Pryor (51609) Maitland G22 Certficate No: 01151-All passed no defects	5/06/2017		442	\$0.00
		Gato Repairs-500 Hr Intermediate Serivce replace all filters and oils except hydraulic oil	3/10/2017		891	\$0.00
		007929-DOO-9kg and 1kg fire extinguishers check ok and valid tag December 2017	1/12/2017		1200	\$0.00
		PRY-Compliance manual updated 8205	20/12/2017		1215	\$0.00
		09/05/17-013247-342 Hours-CAM-Quick hitch buzzer isnt working 21/12/17-007935-1224Hrs- LEA-Quick hitch buzzer is working	21/12/2017		1224	\$0.00

#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262					
		09/05/17-013247-342 Hours-CAM-Work light brackets bounce around too much 21/12/17-007935-1224Hrs-LEA-Work light brackets have previously been replaced	21/12/2017		1224	\$0.00
		RMS-Andrew Bowe-G22 inspection-Score 121- No defects	21/12/2017		1224	\$0.00
		Gato Repairs-Floated to Gato workshop.Updated Diesel Particulate Filter Kit, turbo and DPF harness installed	9/03/2018		1537	\$0.00
		Gato Repairs-500 Hr Intermediate Serivce replace all filters and oils except hydraulic oil	9/03/2018		1537	\$0.00
		007990-LEA-1617Hrs-Unsuccessful attempt to steal fire extinguisher bracket 18/04/18- 007992-LEA-Reattached bracket	18/04/2018		1631	\$0.00
		007020-1835Hrs-AND-Needs new 90" grease nipple on knuckle 31/05/18-007021-1846Hrs- AND/DOO-Replaced faulty grease nipple	31/05/2018		1846	\$0.00
		08/05/18-007004-1701Hrs-AND-Scratches on front and back-previous operator was LEA 20/06/18-PRY-Recorded on LEA record	20/06/2018			\$0.00
		007044-AND/LEA-Turn cutting edge on mud bucket	11/07/2018		2027	\$0.00
		06/12/17-007930-BIS-Mud bucket cutting edge needs turning 007044-AND/LEA-Turn cutting edge on mud bucket	11/07/2018		2027	\$0.00
		08/02/18-007956-1387Hrs-SWE-Needs 12 nuts and bolts to turn mud bucket edge 007044-AND/LEA-Turn cutting edge on mud bucket	11/07/2018		2027	\$0.00
		15/05/18-007009-AND-Outside door lock jammed25/05/18-007017-1812Hrs-AND-same 20/06/18-PRY-Open WO Gato Repairs28/07/18-0452-2143Hrs-Gato Repairs-Checked was working	28/07/2018		2143	\$0.00
		26/04/18-007997-1660Hrs-LEA-Cabin Side Lights Not Working20/06/18-PRY-Open WO Gato Repairs 28/07/18-0452-2143Hrs-Gato Repairs-Checked was working	28/07/2018		2143	\$0.00
		18/07/18-007049-2073Hrs-AND-Grease nipple on RHS of QH needs replacing/burred over- PRY-added to existing Gato work order 28/07/18-0452-2143Hrs-Gato Repairs-Grease nipple replaced	28/07/2018		2143	\$0.00
		0452-Gato Repairs-2000 Hr Major Service All filters, all oils, all belts	28/07/2018		2143	\$0.00
		08/02/18-007956-1387Hrs-SWE-Warranty- Gato-Fire extinguisher bracket broken 20/06/18-PRY-TBC-Pretty sure it has been done 28/07/18-0452-2143Hrs-Gato Repairs- Checked was ok	28/07/2018		2143	\$0.00

#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262	-		- •		
		25/05/18-007017-1812Hrs-AND-Adjustment bar on seat has fallen out 20/06/18-PRY-Open WO Gato Repairs28/07/18-0452-2143Hrs- Gato Repairs-Repaired and refitted	28/07/2018		2143	\$0.00
		09/07/18-007042-2010Hrs-AND-Damaged battery door step 16/08/18008008-NOB-Start repair 23/08/18-NOB-WIP 24/08/18-NOB-WIP 27/08/18-008013-NOB-Refit repaired panel	27/08/2018			\$0.00
		25/08/19-016344-2468Hrs-BIS-Hitch cracked- taken to Gato for repairs 22/10/18-Gato Repairs-Warranty-Lower quick hitch replaced and repaired not incl Labour	22/10/2018		2472	\$0.00
		Gato Repairs-Engine DPF system replaced under warranty	22/10/2018		2472	\$0.00
		Gato Repairs-Faulty aftermarket greaseliness replaced	22/10/2018		2472	\$0.00
		Gato Repairs-500 Hr Major Service All filters, all oils except hydraulic	22/10/2018		2472	\$0.00
		09/11/18-009508-2552Hrs-AND-Machine will not rev after DPF burn-lost 1hr-Gato 009509- 2560Hrs-AND/Gato Repairs-Changed engine oil and lowered enginel oil level was overfull	9/11/2018		2560	\$0.00
		PRY-Compliance Manual Updated 8816	8/02/2019		2889	\$0.00
		LEA-9kg Fire Extinguisher checked, charged and dated	8/02/2019		2889	\$0.00
		LEA-1kg Fire Extinguisher checked, charged and dated	8/02/2019		2889	\$0.00
		RMS G22 Inspection-Andrew Bowe-121 points- No defects	11/02/2019		2894	\$0.00
		12/2/19-009560-2902Hours-NOB-A/C Code HLE-PRY-Brad Gato dust ,dirt in actuator-will put on next service work order 01/05/19-PRY-No issue since or at service	28/03/2019		3234	\$0.00
		0865-Gato Repairs-500 Hr Intermediate Serivce replace all filters and oils except hydraulic oil	28/03/2019		3073	\$0.00
		11/12/18-2711Hrs-009529-NOB-Estop button is lose 28/03/19-3073 Hours-Gato Repairs-Estop replaced	28/03/2019		3234	\$0.00
		009588-LEA-Detail cabin and clean tracks	1/04/2019		3084	\$0.00
		04/04/19-009589-BIS-3082Hrs-Counterweight scratched	4/04/2019			\$0.00
		20/05/19-008515-BIS-3226Hrs-Scratch along counterweight by BIS	20/05/2019			\$0.00
		20/05/19-008515-BIS-3226Hrs-LHS Mirror missing(taken by Cam for PL264)	14/06/2019		3229	\$0.00
		Coastech Auto Electrical-Replace dead batteries	14/06/2019		3229	\$0.00

#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262					
		17/07/19-008534/5-3379Hrs-JAC-Cleaned cab-repaired seat-fixed nipple on hitch-greased machine	17/07/2019		3379	\$0.00
		19/06/19-008523-3293Hrs-Extinguisher trigger pin broken 02/08/19-008538-JAC-External fire extinguisher is missing and has been replaced	2/08/2019			\$0.00
		06/11/18-009505-2528Hrs-AND-Oil leak around pump 28/03/19-Gato-not checked ??? 02/08/19-008538-JAC/LEA-Cant see any oil leak	2/08/2019			\$0.00
		02/09/19-004361- HAM/BEN/HAY/LEA/CAM/JAC>New track chains fitted/track pads re-fitted	2/09/2019			\$0.00
		Gato Repairs-Fit new track chains, sprockets and old PL236 track pads to PL262	2/09/2019		3411	\$0.00
		17/07/19-008536-3382Hrs-JAC-Powewr tilt has been greased but still squeals 23/07/19-DMM-Heathwood Hydraulics-replaced seals refitted by Gato	2/09/2019			\$0.00
		13/02/19-009561-2909Hrs-MAR-Tilt head squeals eventhough its taking grease, this has already been rebuilt once-02/09/19-Repaired by Heathwood Hydraulics & refitted by Gato Repairs	2/09/2019			\$0.00
		12/09/19-008546-MAR-Tilt head squeals no matter how much grease is put in>16/09/19>Grease has taken now>stopped squeal	16/09/2019			\$0.00
		PRY-Compliance manual updated online	7/11/2019		3763	\$0.00
		1330-DMM-Dependable Mechanical Maitenance-500 Hr service, replace all filters and all oils ecept hydraulic, oil samples, oil leak at hyd oil suction hose which was lose	21/11/2019		3838	\$0.00
		PRY-Compliance manual updated online	21/11/2019		3838	\$0.00
		17/12/19-015110-3961Hrs-NOB-Some scratches on back	31/01/2020			\$0.00
		RMS-Andrew Bowe-G22 Inspection-121 points no defects	11/02/2020			\$0.00
		Compliance manual updated-Gosper	11/02/2020			\$0.00
		11/03/2020-015146-AND-DPF issue-Gato to call to talk through	11/03/2020			\$0.00
		24/03/20-9110-JAC- Sydney Trains JAC completed>Stickers/Reflective/Reflectors	24/03/2020			\$0.00
		17/04/20-015164-4201Hrs-AND-Top LHS roller jammed-015165-AND-Replaced LHS carrier roller	20/04/2020		4206	\$0.00
		16/01/20-015113-3980Hrs-AND-Lock missing operators side battery door 13/02/20-015129-4063Hrs-AND-22/04/20-NOB-015168-4210Hrs-Replaced lock	22/04/2020		4210	\$0.00

#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262					
		31/10/18-009503-2512 Hrs-MAR-Door to access coolant wont open 28/03/19-Gato confirmed replacement needed 02/08/19-008538-JAC-Door lock needs 22/04/20-NOB-015168-4210Hrs-Replaced lockreplacement	22/04/2020			\$0.00
		014123/015184/1527-Gato Repairs-2000 Hour major service replaced all filters, replaced all oils, replaced all belts, oil samples & cutting edge replaced on mud bucket	18/05/2020		4285	\$0.00
		05/05/20-015175-4243Hrs-AND-2 Hex bolts missing from quick hitch 21/05/20-Gato Repairs-Missing bolts replaced and all others removed and reinstalled with Loctite	21/05/2020		4296	\$0.00
		21/05/20-015187-4296Hrs-CAM-AC not cooling-rattling noise 22/05/20-015189-4289Hrs-CAM/Gato Repairs-Replace faulty AC compressor and belts	22/05/2020		4298	\$0.00
		21/05/20-015187-4296Hrs-CAM-UHF connector needs soldering 22/05/20015188- 4298Hrs-CAM/CHR-UHF soldered	22/05/2020		4298	\$0.00
		20/05/20-015186-4290Hrs-CAM-No tag on fire extinguisher 22/05/20-015189-4298-CAM-Fit new tag	22/05/2020		4298	\$0.00
		03/06/20-015195-4328Hrs-CAM-Heater not working-Little man flashing 19/06/204374Hrs- Same 29/06/20011813-4408Hrs-Gato-Heating issue repaired	29/06/2020		4408	\$0.00
		24/06/20-011809-4391Hrs-CAM-Small oring hyd oil leak in fitting under hydraulic pump 29/06/20-011813-4408Hrs-gato-Hyd oil leak repaired	29/06/2020		4408	\$0.00
		22/06/20-011807-4380Hrs-CAM-1 x worklight not working 29/06/20-4407Hrs-Gato Repairs-Repaired,tested,working	29/06/2020		4407	\$0.00
		22/06/20-011807-4380Hrs-CAM-Work light cover lose, needs shimming 29/06/20-4407Hrs-Gato Repairs-Repaired,tested,working	29/06/2020		4408	\$0.00
		09/07/20-011819-4438Hrs-CAM-Oil leaking under pump not fixed 10/07/20-011820-4445Hrs-CAM/Gato Repairs-Fit new oring, oil leak fixed	10/07/2020		4445	\$0.00
		19/12/18-009536-2766Hrs-NOB-Handrails front left & back right are broken 28/03/19-Gato confirmed repair is needed 15/07/20-011821-4449Hrs-CAM-Checked-all good	15/07/2020		4449	\$0.00
		21/07/20-011825-4463Hrs-CAM-Oil leak on hyd pump not sure from where, possibly when auger used 22/07/20-011826-4469Hrs- CAM/Gato-Repaired-hose replaced	22/07/2020		4469	\$0.00
		13/02/20-015129-4063Hrs-AND-? new track pads 13/08/20-PRY-Replace when completely worn out	13/08/2020			\$0.00

Gato Repairs-500 Hr Intermediate service, replaced all filters and all oils except hydraulic 15/09/20-011862-4612Hrs-CAM-Oil leak around hyd pump area 16/09/20-011863-4617Hrs-CAM-Same 17/09/20-CAM-? under fuel tank 16/11/20-4766Hrs-Gato-Replaced orings on pump fittings and pressure sensor 18/11/20-010705-4768Hrs-CAM-Oilstill eaking near hydraulic pump 20/11/20-010707-4778Hrs-CAM-Possibly resid oil from pan-PRY-Was only residual oil 18/12/20-010726-010726-4873Hrs-CAM/Gato-Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on hydraulic circuit, new orings fitted	16/11/2020 16/11/2020 20/11/2020	Equip	4766 4766 4873	\$0.00 \$0.00 \$0.00
replaced all filters and all oils except hydraulic 15/09/20-011862-4612Hrs-CAM-Oil leak around hyd pump area 16/09/20-011863- 4617Hrs-CAM-Same 17/09/20-CAM-? under fuel tank 16/11/20-4766Hrs-Gato-Replaced orings on pump fittings and pressure sensor 18/11/20-010705-4768Hrs-CAM-Oilstill eaking near hydraulic pump 20/11/20-010707- 4778Hrs-CAM-Possibly resid oil from pan- PRY-Was only residual oil 18/12/20-010726-010726-4873Hrs-CAM/Gato- Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on	16/11/2020 20/11/2020 18/12/2020		4766	\$0.00 \$0.00
replaced all filters and all oils except hydraulic 15/09/20-011862-4612Hrs-CAM-Oil leak around hyd pump area 16/09/20-011863- 4617Hrs-CAM-Same 17/09/20-CAM-? under fuel tank 16/11/20-4766Hrs-Gato-Replaced orings on pump fittings and pressure sensor 18/11/20-010705-4768Hrs-CAM-Oilstill eaking near hydraulic pump 20/11/20-010707- 4778Hrs-CAM-Possibly resid oil from pan- PRY-Was only residual oil 18/12/20-010726-010726-4873Hrs-CAM/Gato- Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on	16/11/2020 20/11/2020 18/12/2020		4766	\$0.00 \$0.00
around hyd pump area 16/09/20-011863-4617Hrs-CAM-Same 17/09/20-CAM-? under fuel tank 16/11/20-4766Hrs-Gato-Replaced orings on pump fittings and pressure sensor 18/11/20-010705-4768Hrs-CAM-Oilstill eaking near hydraulic pump 20/11/20-010707-4778Hrs-CAM-Possibly resid oil from pan-PRY-Was only residual oil 18/12/20-010726-010726-4873Hrs-CAM/Gato-Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on	20/11/2020			\$0.00
near hydraulic pump 20/11/20-010707- 4778Hrs-CAM-Possibly resid oil from pan- PRY-Was only residual oil 18/12/20-010726-010726-4873Hrs-CAM/Gato- Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on	18/12/2020		4873	
Quick hitch would not release bucket, repaired by replacing orings in valve, all ok 010735-CAM/Gato Repairs-Oring failure on			4873	\$0.00
	04/04/0004			
	21/01/2021		4913	\$0.00
010736-4918Hrs-CAM/Gato Repairs-Quick hitch wont release, spool valve orings and lines replaced	22/01/2021		4918	\$0.00
02/02/21-010741-4934Hrs-CAM-Fitting missing off hyd cap filler-010742-CAM/Gato Repairs-Fitted grommet to hydraulic tank lid	3/02/2021		4935	\$0.00
18/12/20-010726-010726-4873Hrs-CAM-Fire extinguisher bracket is broken 19/01/21-010733-4901Hrs-CAM-Same, needs replacement 03/02/21-010742-CAM-New bracket from Gato fitted	3/02/2021		4935	\$0.00
010748-LEA-1 Kg fire extinguisher checked, it is charged,tagged & dated	10/02/2021		4961	\$0.00
PRY-Compliance manual updated	11/02/2021		4964	\$0.00
010749-CAM/LEA-New 9kg fire extinguisher mount and extinguisher fitted 12/07/21	12/02/2021		4970	\$0.00
G22 Inspection-TfNSW-David Williams-121 points	17/02/2021		4989	\$0.00
28/04/21-010793-5088Hrs-CAM-Tilt hitch leaking from rear seal, later sealed	28/04/2021			\$0.00
Gato Repairs: 500 Hr Intermediate service, replaced all filters and all oils except hydraulic	15/06/2021		5251	\$0.00
18/09/20-013696-4895-RHS front Idler guides need replacing 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit	17/06/2021		5257	\$0.00
17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit	18/06/2021		5257	\$0.00
012833-AND/CAM-Replace top track carrier roller	25/06/2021		5280	\$0.00
	010736-4918Hrs-CAM/Gato Repairs-Quick hitch wont release, spool valve orings and lines replaced 02/02/21-010741-4934Hrs-CAM-Fitting missing off hyd cap filler-010742-CAM/Gato Repairs-Fitted grommet to hydraulic tank lid 18/12/20-010726-010726-4873Hrs-CAM-Fire extinguisher bracket is broken 19/01/21-010733-4901Hrs-CAM-Same, needs replacement 03/02/21-010742-CAM-New bracket from Gato fitted 010748-LEA-1 Kg fire extinguisher checked, it is charged,tagged & dated PRY-Compliance manual updated 010749-CAM/LEA-New 9kg fire extinguisher mount and extinguisher fitted 12/07/21 G22 Inspection-TfNSW-David Williams-121 points 28/04/21-010793-5088Hrs-CAM-Tilt hitch leaking from rear seal, later sealed Gato Repairs: 500 Hr Intermediate service, replaced all filters and all oils except hydraulic 18/09/20-013696-4895-RHS front Idler guides need replacing 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit	010736-4918Hrs-CAM/Gato Repairs-Quick hitch wont release, spool valve orings and lines replaced 02/02/21-010741-4934Hrs-CAM-Fitting missing off hyd cap filler-010742-CAM/Gato Repairs-Fitted grommet to hydraulic tank lid 18/12/20-010726-010726-4873Hrs-CAM-Fire extinguisher bracket is broken 19/01/21-010733-4901Hrs-CAM-Same, needs replacement 03/02/21-010742-CAM-New bracket from Gato fitted 010748-LEA-1 Kg fire extinguisher checked, it is charged,tagged & dated PRY-Compliance manual updated 11/02/2021 010749-CAM/LEA-New 9kg fire extinguisher mount and extinguisher fitted 12/07/21 G22 Inspection-TfNSW-David Williams-121 points 28/04/21-010793-5088Hrs-CAM-Tilt hitch leaking from rear seal, later sealed Gato Repairs: 500 Hr Intermediate service, replaced all filters and all oils except hydraulic 18/09/20-013696-4895-RHS front Idler guides need replacing 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 012833-AND/CAM-Replace top track carrier 25/06/2021	010736-4918Hrs-CAM/Gato Repairs-Quick hitch wont release, spool valve orings and lines replaced 02/02/21-010741-4934Hrs-CAM-Fitting missing off hyd cap filler-010742-CAM/Gato Repairs-Fitted grommet to hydraulic tank lid 18/12/20-010726-010726-4873Hrs-CAM-Fire extinguisher bracket is broken 19/01/21-010733-4901Hrs-CAM-Same, needs replacement 03/02/21-010742-CAM-New bracket from Gato fitted 010748-LEA-1 Kg fire extinguisher checked, it is charged, tagged & dated PRY-Compliance manual updated 11/02/2021 010749-CAM/LEA-New 9kg fire extinguisher mount and extinguisher fitted 12/07/21 G22 Inspection-TfNSW-David Williams-121 points 28/04/21-010793-5088Hrs-CAM-Tilt hitch leaking from rear seal, later sealed Gato Repairs: 500 Hr Intermediate service, replaced all filters and all oils except hydraulic 18/09/20-013696-4895-RHS front Idler guides need replacing 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 012833-AND/CAM-Replace top track carrier 22/01/2021 22/01/2021 3/02/2021 3/02/2021 3/02/2021 10/02/2021 10/02/2021 10/02/2021	010736-4918Hrs-CAM/Gato Repairs-Quick hitch wont release, spool valve orings and lines replaced 22/01/2021 4918 02/02/21-010741-4934Hrs-CAM-Fitting missing off hyd cap filler-010742-CAM/Gato Repairs-Fitted grommet to hydraulic tank lid 3/02/2021 4935 18/12/20-010726-010726-4873Hrs-CAM-Fitre extinguisher bracket is broken 19/01/21-010733-4901Hrs-CAM-Same, needs replacement 03/02/21-010742-CAM-New bracket from Gato fitted 3/02/2021 4935 010748-LEA-1 Kg fire extinguisher checked, it is charged, lagged & dated 10/02/2021 4961 PRY-Compliance manual updated 11/02/2021 4964 010749-CAM/LEA-New 9kg fire extinguisher mount and extinguisher fitted 12/07/21 12/02/2021 4970 G22 Inspection-TfNSW-David Williams-121 points 17/02/2021 4989 28/04/21-010793-5088Hrs-CAM-Tilt hitch leaking from rear seal, later sealed 28/04/2021 5251 Gato Repairs: 500 Hr Intermediate service, replaced all filters and all oils except hydraulic 15/06/2021 5251 18/09/20-013696-4895-RHS front Idler guides need replacing 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 18/06/2021 5257 17/06/21-012827-Idler tension nut broken, 012828-Gato Repairs-Replace broken idler tension rod and spring with a 2nd hand unit 18/06/2021 5257

			Miles/km on Hours on			
#	Equip Num	Repair Description	Repair Date	Miles/km on Equip	Hours on Equip	Cost
1	1-PL262					
		07/06/21-012820-5217Hrs-CAM-Heater not working 23/06/21-012831-5271Hrs-CAM- Same 29/06/21-012834-5283Hrs-CAM-New actuators installed by Gato 28/06/21	29/06/2021		5283	\$0.00
		HD-13082-CAM-900mm Mud bucket, new edge and teeth infills manufactured at Gato	7/10/2021			\$0.00
		10/12/2021-018724-CAM-West Tankers driver broke external Estop-Gato Repairs-Broken Estop replaced	10/12/2021		5633	\$0.00
		15/12/21-018727-5662Hrs-CAM-Hyd oil leak around pump area 17/12/21-018729-5681Hrs- CAM-Gato Repairs-Oil leak fixedReplaced Oring on dozer circuit and hyd pump 2	17/12/2021		5681	\$0.00
		01742-Gato Repairs-Fit Oring on hyd pump fitting	14/01/2022		5775	\$0.00
		2592-Gato Repairs-500 Hr Intermediate service, replaced all filters and all oils except hydraulic,fix UHF radio fitting	2/02/2022		5821	\$0.00
		018764-CAM-Replaced 1kg fire extinguisher with new dated 09/21, replaced 9kg fire extinguisher with new dated 01/22,	18/02/2022		5943	\$0.00
		G22 Inspection Report No: 01171-No defects- Greg Pryor	18/02/2022		5943	\$0.00
		22/03/2022-018788-CAM/Gato Repairs- Leaking oring at hydraulic pump fitting replaced	22/03/2022		6024	\$0.00
		TfNSW G22 Inspection-David Williams-121 Points-Passed	28/03/2022		6055	\$0.00
		14/10/19-008564-MAR-Rock on track damaged panel under cab-22/01/20-015117-AND-Floor Panel under cab damaged 01/04/22-PRY-Noted	1/04/2022			\$0.00
		09/02/2022-018756-5879Hrs-CAM-Oil leak near quick hitch ram-01/04/22-PRY-Add to work order for next service 07/012/2022 SR003702-Gato Repairs-Not evident	12/07/2022			\$0.00
		SR003702-Gato Repairs-Manufacturers handbook service	12/07/2022		6512	\$0.00
		29/06/22-019644-6490Hrs-CAM-Engine oil leak 07/12/22-SR003702-Gato Repairs-Oil leak coming from main timeingcase- 16/08/2022-Gato Repairs-Crankshaft oil seal replaced under warranty	16/08/2022		6628	\$0.00
			Cont For Front 1	l 4 DI 000 E	ultania asteete	# 0.00
		Total	Cost For Equip N		criteria selected	\$0.00 \$0.00
				100	ai GUSLOVEI AII	φ0.0