



SCANIA



Dealer Support Centre
212-216 Northbourne Road Campbellfield Vic 3061
Private Bag 11 Campbellfield Vic 3061
Telephone: +61 3 9217 3300
Fax: +61 3 9305 3898
ABN 44 000 537 333 / ACN 000 537 333

Scania Australia - Up To Roadworthy Standard Certificate

For the Qube Logistics vehicles on a repair and maintenance agreement, Scania Australia's commitment to well maintained and safe vehicles is supported by its own "up to roadworthy standard certificate". With Scania trained technicians repairing and maintaining the vehicles and an annual brake test performed, the vehicles are sure to always be in the best condition.

A full service history is stored within the Scania Dealer Management System.

This certificate confirms the vehicle listed below was serviced and in a roadworthy condition when it was released from the Scania Branch.

Scania Branch	WINGFIELD
Date of service	23.8.22
Chassis	9213645
Registration	SB 81KT
Odometer	389655

Signed: [Signature]

Name: A. NICHOLLS

Date: 23.8.22

Scania Australia Pty Ltd

Victoria
Campbellfield 03 9217 3300
Dandenong 03 9217 3600
Leverton 03 9369 8666

New South Wales
Prestons 02 9825 7900
Newcastle 02 9825 7940

Queensland
Richlands 07 3712 8500
Pinkenba 07 3712 7900

South Australia
Wingfield 08 8406 0200

Western Australia
Kewdale 09 9360 8500
Bunbury 08 9724 6200




SCANIA
Scania Australia

Extinguisher Inspection Guide QUBE TRUCKS ONLY

3 - Actuating Device

1 - Anti-tamper Device

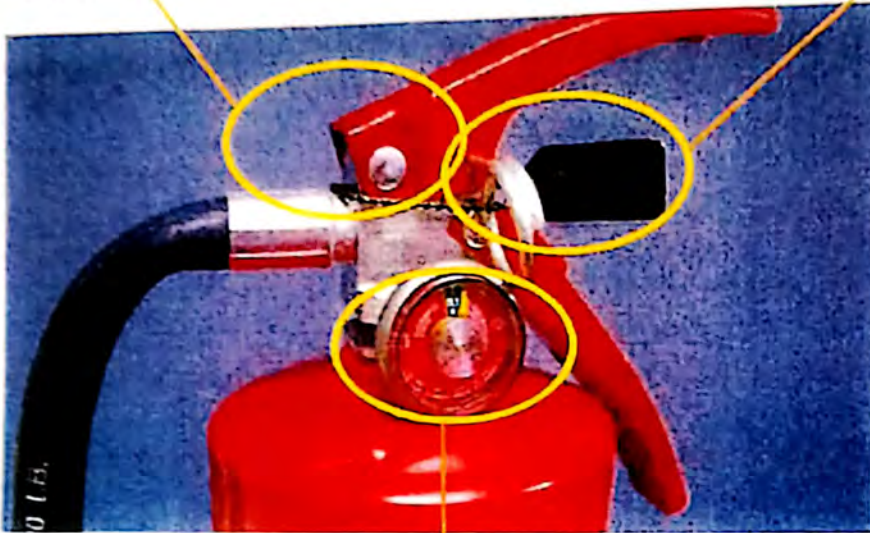

2 - Pressure Indicator

4 - Inspection date stamp

DATE	NAME	SIGNATURE	LOCATION
23.8.22	ANDY	<i>[Signature]</i>	CABIN

Heavy Vehicle Inspection Checklist

This checklist is used to complete a vehicle inspection that meets maintenance management standard 4 criteria(4). The inspection must be completed or supervised by a suitably qualified person whose name and signature must appear on the form.

*These fields are not mandatory.

Registration # **SB91KT**
 Reason for Inspection* **Annual**
 Inspection Date **23/8/22**
 Inspection Time* **12:00pm**
 Odometer **357,850**
 Registration Expiry Date*

Owner's Details
 Inspection location* **Scanlon Whitehill**
 Make* **Scania**
 Model* **G440**
 VIN or Fleet # **PN126**
 Vehicle Colour* **White**

Cross out those items not applicable.

Tick for Pass Cross for Fail

Item	Pass <input type="checkbox"/>	Fail <input type="checkbox"/>
Identification		
1 Registration Plates Affixed and Legible	<input type="checkbox"/>	<input checked="" type="checkbox"/>
2 Compliance Plate Affixed	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Lights / Electrical		
3 Park / Tail / Number Plate / Clearance	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4 Head Lights / Auxiliary Lights	<input checked="" type="checkbox"/>	<input type="checkbox"/>
5 Brake Lights	<input checked="" type="checkbox"/>	<input type="checkbox"/>
6 Reflectors / Lenses	<input checked="" type="checkbox"/>	<input type="checkbox"/>
7 Warning Device / Turning Indicators	<input checked="" type="checkbox"/>	<input type="checkbox"/>
8 Wipers / Washers	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Glazing		
9 Material / Visibility	<input checked="" type="checkbox"/>	<input type="checkbox"/>
10 Window Operation	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Seats / Seat Belts		
11 Mountings / Construction	<input checked="" type="checkbox"/>	<input type="checkbox"/>
12 Fitting / Operation / Condition	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Wheels & Tyres		
13 Wheels / Security	<input checked="" type="checkbox"/>	<input type="checkbox"/>
14 Wheel Bearings	<input checked="" type="checkbox"/>	<input type="checkbox"/>
15 Tyres Tread Depth & Condition	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Body / Fittings/ Protrusions		
16 Corrosion / Security / Damage	<input checked="" type="checkbox"/>	<input type="checkbox"/>
17 Door / Bonnet / Catches	<input checked="" type="checkbox"/>	<input type="checkbox"/>
18 Rear Vision Mirrors	<input checked="" type="checkbox"/>	<input type="checkbox"/>
19 Rear Marker Plates	<input checked="" type="checkbox"/>	<input type="checkbox"/>
20 Body Fittings / Bumper Bars	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tow Couplings		
21 Auto Tow Couplings	<input checked="" type="checkbox"/>	<input type="checkbox"/>
22 King Pin / Skid Plate	<input checked="" type="checkbox"/>	<input type="checkbox"/>
23 Tow Eye / Drawbar / Safety Chains	<input checked="" type="checkbox"/>	<input type="checkbox"/>
24 Ball Race Turn Table	<input checked="" type="checkbox"/>	<input type="checkbox"/>
25 Goose Neck	<input checked="" type="checkbox"/>	<input type="checkbox"/>

Tick for Pass Cross for Fail

Item	Pass <input type="checkbox"/>	Fail <input type="checkbox"/>
Braking		
26 Brake Components	<input checked="" type="checkbox"/>	<input type="checkbox"/>
27 Brake Operation(Refer Notes)	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Steering		
28 Steering Box / Pitman Arm	<input checked="" type="checkbox"/>	<input type="checkbox"/>
29 Arms / Linkages / Wheel	<input checked="" type="checkbox"/>	<input type="checkbox"/>
30 King Pins	<input checked="" type="checkbox"/>	<input type="checkbox"/>
31 Free Play	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Suspension		
32 Springs	<input checked="" type="checkbox"/>	<input type="checkbox"/>
33 Hangers / Pins / Bushes	<input checked="" type="checkbox"/>	<input type="checkbox"/>
34 Air Bags / Air Suspension	<input checked="" type="checkbox"/>	<input type="checkbox"/>
35 Shock Absorbers	<input checked="" type="checkbox"/>	<input type="checkbox"/>
36 Axles / Cross Members	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Oil / Fuel Leaks		
37 Engine / Driveline	<input checked="" type="checkbox"/>	<input type="checkbox"/>
38 Steering / Accessories	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Exhaust		
39 Leaks / Design / Security	<input checked="" type="checkbox"/>	<input type="checkbox"/>
40 Emissions	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Mountings		
41 Engine / Transmission	<input checked="" type="checkbox"/>	<input type="checkbox"/>
42 Body	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Air Systems		
43 Leaks / Low Air Warning / Contamination	<input checked="" type="checkbox"/>	<input type="checkbox"/>
44 Breakaway Protection	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Under body / Chassis		
45 Cracks / Security	<input checked="" type="checkbox"/>	<input type="checkbox"/>
46 Corrosion	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Mudguards / Mud Flaps		
47 Fitted as Required	<input checked="" type="checkbox"/>	<input type="checkbox"/>

Notes:

1. If manufacture specifications are unknown refer to the Heavy Vehicle Inspection Manual for minimum requirements
2. For a heavy vehicle built after 1930, the service brake must bring the vehicle or combination to a stop within 16.5m from a speed of 35km/h.
3. Trailer breakaway protection must be checked for operation.

Name: Daniel

Signature: 



Dealer Support Centre
 212-216 Northbourne Road Campbellfield Vic 3061
 Private Bag 11 Campbellfield Vic 3061
 Telephone: + 61 3 9217 3300
 Fax: + 61 3 9305 3898
 ABN 44 000 537 333 / ACN 000 537 333

Qube Logistics National safety equipment audit

Truck Model: G480
 Chassis Number: 9213645
 Rego Number: SBS1KT
 Fleet Number: PM126

Chassis mounted grab handle: YES/NO
 Chassis mounted grab handle colour: YELLOW/BLACK
 Rear of cab handle: YES/NO
 Rear of cab handle colour: YELLOW/BLACK
 Type of rear of cab grab handle: AERO KIT YES/NO
 In cabin fire extinguisher in place: YES/NO
 In cabin fire extinguisher expiry date: DATE N/A
 Rear of cab fire extinguisher in place: YES/NO
 Rear of cab fire extinguisher in place: DATE N/A
 Door open park brake off alert working: YES

Workshop carrying out inspection: SCANIA WINGFIELD

Technician Name: ANDY

Signed: M Date inspected: 23-8-22

Scania Australia Pty Ltd

Victoria
 Campbellfield 03 9217 3300
 Dandenong 03 9217 3600
 Laverton 03 9369 8666

New South Wales
 Prestons 02 9825 7900
 Newcastle 02 9825 7940

Queensland
 Richlands 07 3712 8500
 Pinkenba 07 3712 7900

South Australia
 Wingfield 08 8406 0200

Western Australia
 Kewdale 08 9360 8500
 Bunbury 08 9724 6200

Chassis:9213645

Timestamp: 11/10/2022 08:24:53

WO No	Inv No	Chassis	Rego No	Fleet No	Kms	Inv date	Service Date	Job line	Item No	Qty	Description
51051459	51224064	9213645	SB81KT	PM126	73832	23 Mar 2018	23 Mar 2018	JOB 8;			Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
51051459	51416033	9213645	SB81KT	PM126	73832	23 Mar 2018	23 Mar 2018	JOB 2;			170501, Gear shifting difficulties, OPC overpressure [3, ,] Factory-requested campaign,, [97, ,] because of Factory-ordered campaign,
									2621825	1	PLUG Campaign, *** GST DEDUCTED!
51051459	51508827	9213645	SB81KT	PM126	73832	23 Mar 2018	23 Mar 2018	JOB 3;			21/04/2018 Bas_1 = Basic 80420 km 0.70 H Version: . Additional work: Turntable lubrication Duration: 0.2 Additional work: Contracts Plus extras Duration: 1 Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1 BASIC MAINTENANCE BASIC MAINTENANCE 3-5 axles
									2277578	1	INSPECTION KIT
									2544995	1	FILTER
									1852189	1	PREFILTER
								JOB 4;			21/04/2018 Ch_1 = Chassis 1 80420 km 0.60 H Version: . Maintenance, chassis 1., 3-4 axles 3-4 axles
								JOB 5;			21/04/2018 Br_1 = brake test 80420 km 0.50 H Version: . Additional work: Annual Safety Inspection Duration: 0.1 Maintenance, brake test., 2-3 axles 2-3 axles
								JOB 6;			21/04/2018 Bat_2 = Batteries 80420 km 0.30 H Version: . Batteries maintenance.,
								JOB 7;			21/04/2018 Radiator & intercooler external clean 80630 km 0.00 H Additional work: Radiator & intercooler clean Duration: 0.9 Clean 2 radiators for engine. Incl. clean charge air cooler. Next inspection mileage: 86240 SUNDRY ITEMS GST DEDUCTED!
51052433	51224670	9213645	SB81KT	PM126	86692	07 Jun 2018	06 Jun 2018	JOB 8;			Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
51052433	51509113	9213645	SB81KT	PM126	86692	07 Jun 2018	06 Jun 2018	JOB 2;			Basic Mileage: 87380 Duration: 0.7 Additional work: Turntable lubrication Duration: 0.2 Additional work: Contracts Plus extras Duration: 1 Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1 BASIC MAINTENANCE
									2153365	1	OIL FILTER INSERT BASIC MAINTENANCE 3-5 axles
									300011646	0.5	SCANIA GP GREASE (180KG DRUM)
									2405798	43	LDF3 IBC

JOB 3;	ENV	1 ENVIROMENT LEVY Fuel filter Mileage: 88920 Duration: 0.4 Maintenance, fuel system. PDE
	1873018	1 FILTER
JOB 4;	1873018	1 FILTER Centrifugal oil cleaner Mileage: 87380 Duration: 0.2 Maintenance, centrifugal oil cleaner.,
	1769799	1 O-RING ENG
	1769800	1 ORING OIL CLEANER
	1769799	1 O-RING ENG
JOB 5;	2153365	1 OIL FILTER INSERT Engine Mileage: 88920 Duration: 0.5 Fluid: Engine : Engine oil LDF-3 , 41 Maintenance, engine oil., DC09-DC16 DC09-DC16
	0750226	1 ORING
	1328242	1 ORING
	2022275	1 REP KIT
JOB 6;	2419091	1 WASHER Chassis lubrication Mileage: 88920 Duration: 0.6 Maintenance, fifth wheel., Tractor Tractor Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4
JOB 7;		Reductant filter Mileage: 119800 Duration: 0.3 Maintenance, SCR., Reductant filter With prefilter Reductant filter With prefilter
	2544995	1 FILTER
	1852189	1 PREFILTER Next inspection mileage: 130030 SUNDRY ITEMS GST DEDUCTED!

51053043	51225105	9213645	SB81KT	PM126	96660	31 Jul 2018	27 Jul 2018	JOB 2;	Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
51053043	51509333	9213645	SB81KT	PM126	96660	31 Jul 2018	27 Jul 2018	JOB 1;	12/06/2018, 88070 km, = Annual Wheel Alignment, 2 h. Subcon to laser alignment Travel to vehicle/engine. Scania Assistance for repair work on customer's premises. CARRY OUT WHEEL ALIGNMENT Next inspection mileage: 130710 SUNDRY ITEMS GST DEDUCTED!
51053064	51225117	9213645	SB81KT	PM126	96660	31 Jul 2018	30 Jul 2018	JOB 2;	Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
51053064	51509342	9213645	SB81KT	PM126	96660	31 Jul 2018	30 Jul 2018	JOB 1;	BREAKDOWN VEHICLE AT ARGENT RD KINGSFORD - CUSTOMER SUSPECTS FLAT BATTERIES. Callout, travelled to workshop for parts, then travelled to vehicle from Cormack Rd, Wingfield to Kingswood (50 km round trip). Replaced batteries. AFTER HOURS CALLOUT



										CALL MILE	After hours callout. Includes mileage cost within 25km of Start Location, callout fee and first two hours labour. {Applies all weekends, public holidays and before 7.00am and after 5.00pm Mon - Fri 1 W/SHOP CALL OUT FEE 50 MILEAGE Travel to vehicle/engine. Scania Assistance for repair work on customer's premises.
										N150LMF	Check batteries, 2 off. Incl. remove and fit battery cover, use hydrometer. Renew 1 or 2 batteries. 2 BATTERY SUNDRY ITEMS GST DEDUCTED!
51053456	51509470	9213645	SB81KT	PM126	98378	28 Aug 2018	28 Aug 2018	JOB 1;			CUSTOMER COMPLAINT - The exhaust bracket and pipe has fallen off . C: Found failed exhaust clamp. R: Removed and replaced clamp, checked- all ok. Additional time needed to remove cover, walkplate and to secure exhaust pipe. Group LABOUR ----- Renew 1-2 V-clamps for exhaust system. SECURE TAILPIPE
										2053659	1 CLAMP SUNDRY ITEMS GST DEDUCTED!
51054676	51226127	9213645	SB81KT	PM126	110661	28 Nov 2018	23 Nov 2018	JOB 1;			Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
51054676	51509910	9213645	SB81KT	PM126	110661	28 Nov 2018	23 Nov 2018	JOB 2;			DIAGNOSE AND REPORT - GEARBOX MALFUNCTION. Found internal fault in ECA. Organised tow. Removed ECA and loom. Fitted s/e ECA and new loom. Fitted new pins to ECU plug. Checked clutch function and adaption - all ok. Carried out road test -all ok Group LABOUR ----- Check ECA. Incl. use Scania Diagnos. Renew ECA on clutch control Opticruise, incl. using Scania Diagnos. Drain and refill ECA for the Opticruise clutch. Incl. bleed the clutch control, use Scania Diagnos. Test drive vehicle.
										0574952 2709624 1725236	1 ECA 1 CABLE H 4 BOLT TOW VEHICLE SUNDRY ITEMS GST DEDUCTED!
51055241	51226519	9213645	SB81KT	PM126	133602	14 Jan 2019	03 Jan 2019	JOB 44;			Rectify adblue cap leaking. Found to be loose. Tightened cap as required and cleared breather pipe. Checked- all ok
51055241	51510119	9213645	SB81KT	PM126	133602	14 Jan 2019	03 Jan 2019	JOB 1;			FLEX MAINTENANCE

SCA, FMC 006, Fleet Management Campaign (FMC) Cube
 FMC006
 Adjust rear suspension +40mm and -40mm from drive height.

Procedure as per below.

Plug SDP3 into vehicle
 Go to checks & adjustments
 Select Calibration of Drive Axle Levels
 Set normal ride height click next
 Raise vehicle +40 click next
 Lower vehicle -40 (Below normal ride height) then click finish.

To be charged to contracts.

JOB 4;

24/01/2019 Bas_1 = Basic 126150 km 0.70 H Version: .
 Additional work: Contracts Plus extras Duration: 1
 Package (1 times) 00168101 =====
 Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
 Check and replace any blown fuses.
 Check all fluids and top up where necessary.
 Check and carry out any software updates if available.
 Check all tyre pressures and inflate any under inflated tyres to correct pres: re.
 General non time consuming tasks.

Carry out Contracts Plus checks

=====

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
 Additional work: Turntable lubrication Duration: 0.2

BASIC MAINTENANCE
 BASIC MAINTENANCE 3-5 axles

JOB 5;

24/01/2019 Fue_1 = Fuel filter 126150 km 0.40 H Version: .
 Maintenance, fuel system. PDE

1873018

1 FILTER

JOB 6;

24/01/2019 Cen_1 = Centrifugal oil cleaner 126150 km 0.20 H Version: .
 Maintenance, centrifugal oil cleaner,.

1769799

1 O-RING ENG

1769800

1 ORING OIL CLEANER

2153365

1 OIL FILTER INSERT

JOB 7;

24/01/2019 Eng_1 = Engine 126150 km 0.50 H Version: .
 Fluid description: Engine oil LDF-3 Quantity: , 41
 Maintenance, engine oil,, DC09-DC16 DC09-DC16

0750226

1 ORING

1328242

1 ORING



	2625884	1 REP KIT
	2419091	1 WASHER
JOB 8;		24/01/2019 Cgr_1 = Chassis lubrication 126150 km 0.60 H Version: . Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4 Maintenance, fifth wheel., Tractor Fifth wheel
JOB 9;		24/01/2019 Ge_1 = Gearbox 132640 km 0.40 H Version: . Fluid description: Scania Gear oil 80W/140 Quantity: , 16.5 MAINTENANCE, OPTICRUISE Maintenance, gearbox oil. Manual
	2002705	1 OIL FILTER G/BOX
	0349419	2 O-RING ENG
JOB 10;		24/01/2019 Ax_1 = Rear central gears 132640 km 0.70 H Version: . Fluid description: Scania Gear oil 80W/140 Quantity: , 28 Maintenance, axle gear oil, Rear axles 6x4, 6x6, 8x4, 8x6, Rear axles 6x4, 6x6, 8x4, 8x6, 8x8, 8x4*4, 8x4/4, 8x6/4, 10x4*6
	2002705	1 OIL FILTER G/BOX
	2001228	2 WASHER
	2405798	46 LDF3 IBC
	2548888	41 SCANIA GEAR OIL
	2546264	7 ENGINE OIL E7 15W-40 IBC
	4095180	0.5 RENOLIT XTB2 GREASE 180KG (PRICE PER KG)
	ENV	1 ENVIROMENT LEVY
JOB 11;		24/01/2019 Radiator & intercooler external clean 135890 km 0.90 H Additional work: Radiator & intercooler clean Duration: 0 Clean 2 radiators for engine. Incl. clean charge air cooler. Operation 02015088, previously performed on 23/03/2018 at site ADL, Dealer SCANIA, is related to work order 51051459. Previous mileage 73832
JOB 12;		24/01/2019 Ch_1 = Chassis 1 136060 km 0.60 H Version: . Maintenance, chassis 1., 3-4 axles 3-4 axles
JOB 13;		24/01/2019 Br_1 = brake test 136060 km 0.50 H Version: . Additional work: Annual Safety Inspection Duration: 0.1 Maintenance, brake test., 2-3 axles 2-3 axles
JOB 14;		24/01/2019 Bat_2 = Batteries 136060 km 0.30 H Version: . Batteries maintenance.,
JOB 15;		24/01/2019 A/C Service 141020 km 1.90 H Additional work: A/C service Duration: 0

RTA No AU07116 Exp 01.12.2019

1772730	1 DRYER
1772728	1 EXPANSION VALVE
1908345	1 O-RING
1908346	1 O-RING
1377373	1 O-RING



JOB 18; 24/01/2019 Ai_1 = Air filter 141020 km 0.20 H Version: .
Maintenance, air filter.,

1869993 1 AIR FILTER
1913500 1 FILTER

JOB 19; 24/01/2019 Des_1 = Desiccant container 141020 km 0.20 H Version: .
Dessicant container maintenance., All All

2562323 1 FILTER

JOB 20; 24/01/2019 Va_1 = Valve adjustment 141020 km 1.10 H Version: .
Maintenance, valve clearance., DC11-DC13 PDE, XPI DC11-DC13 PDE, XPI

JOB 21; 24/01/2019 Clu_1 = Clutch fluid 141020 km 0.70 H Version: .
Opticruise maintenance., With ECA With ECA
Clutch fluid maintenance., Manual Manual

JOB 22; 24/01/2019 Fut_1 = Fuel tank 141020 km 0.20 H Version: .
Maintenance on fuel tank., Diesel Diesel

2240905 2 FILTER
SUNDRY ITEMS
GST DEDUCTED!

57409 51227819 9213645 SB81KT PM126 167340 12 Jun 2019 04 Jun 2019 JOB 10;

Repairs

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

57409 51510853 9213645 SB81KT PM126 167340 12 Jun 2019 04 Jun 2019 JOB 1;

11/06/2019 Annual Wheel Alignment 172300 km 2.00 H
Package 13008950 (1 times) =====MEASURE ALL WHEEL ANGLES AND ROLLING DIRECTION ON ALL AXLES
Check and adjust all tyre pressures. Measure all wheel angles and rolling direction using computer aided laser on all front and rear axles. Print report.

If alignment is out of specification, a failure report must be submitted. Package 13008951 must be added to the job, to make adjustments.
Measure toe-in and rolling direction using computer-aided laser on twin front axles and rear axles.

JOB 2;

L03066

11/06/2019 Bas_1 = Basic 172300 km 0.70 H Version: .

1 FIRE EXTINGUISHER ABE 2.0KG

Additional work: Turntable lubrication Duration: 0.2

Additional work: Contracts Plus extras Duration: 1

Package (1 times) 00168101 =====

Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.

Check and replace any blown fuses.

Check all fluids and top up where necessary.

Check and carry out any software updates if available.

Check all tyre pressures and inflate any under inflated tyres to correct pressure.

General non time consuming tasks.

Carry out Contracts Plus checks



Operation 00168102, previously performed on 3/01/2019 at site ADL, Dealer SCANIA, is related to work order 51055241. Previous mileage 133602

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1

BASIC MAINTENANCE

BASIC MAINTENANCE 3-5 axles

JOB 3;

11/06/2019 Cen_1 = Centrifugal oil cleaner 172300 km 0.20 H Version: .

Maintenance, centrifugal oil cleaner.,

1769799

1 O-RING ENG

1769800

1 ORING OIL CLEANER

2153365

1 OIL FILTER INSERT

JOB 4;

11/06/2019 Fue_1 = Fuel filter 176670 km 0.40 H Version: .

Maintenance, fuel system. PDE

1873018

1 FILTER

JOB 5;

11/06/2019 Eng_1 = Engine 176670 km 0.50 H Version: .

Fluid description: Engine oil LDF-3 Quantity: , 41

Maintenance, engine oil., DC09-DC16 DC09-DC16

0750226

1 ORING

1328242

1 ORING

2625884

1 REP KIT

2419091

1 WASHER

2405798

44 LDF3 IBC

2546263

7.7 ENGINE OIL E7 15W-40 205L

4095180

0.5 RENOLIT XTB2 GREASE 180KG (PRICE PER KG)

ENV

1 ENVIROMENT LEVY

JOB 6;

11/06/2019 Cgr_1 = Chassis lubrication 176670 km 0.60 H Version: .

Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4

Maintenance, fifth wheel., Tractor Fifth wheel

JOB 7;

11/06/2019 Ret_1 = Retarder 196910 km 0.30 H Version: .

Fluid description: ATF Dexron III Quantity: , 7.7

Maintenance, retarder oil. Retarder

1893214

1 RETARDER INSPECTION KIT

JOB 8;

11/06/2019 Red_1 = Reductant filter 206800 km 0.30 H Version: .

Maintenance, SCR., Reductant filter With prefilter Reductant filter With prefilter

2544995

1 FILTER

1852189

1 PREFILTER

JOB 9;

Next inspection mileage: 215310

Diagnose and report thru shaft seal leak. Found failed seal. Removed and replaced as required.

Carried out road test -all ok

Group LABOUR -----

Renew 1 sealing ring or renew end yoke on rear axle output shaft. Incl. check and fill oil.

1525988

1 NUT

1528991

1 OIL SEAL



2145983

4 FLANGE SCREW
SUNDRY ITEMS
GST DEDUCTED!

1060739 51229985 9213645 SB81KT PM126 201131 13 Jan 2020 02 Jan 2020 JOB 16;

Repair
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

1060739 51512183 9213645 SB81KT PM126 201131 13 Jan 2020 02 Jan 2020 JOB 1;

2405795

1 LDF3 5L
"CARRY OUT AVI. THIS MUST INCLUDE SCANIA UP TO RWC STANDARDS SHEET
SERVICE SHEETS
BRAKE TEST SHEET
SPEED LIMITER SHEET AND NAMED CORRECTLY, SO THEY ARE UPLOADED TO THE PORTAL
"

JOB 2;

JOB 3;

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE
Check and replaced globes as required.

JOB 4;

FIFTH WHEEL: Check for Wear & Function and Lubricate

JOB 5;

Lubricate fifth wheel. Incl. check clearance, check wear.
2/01/2020 Radiator & intercooler external clean 205380 km 0.90 H
Additional work: Radiator & intercooler clean Duration: 0
Package 020100009061 Radiator clean charge air cooler out ==
EXTERNAL CLEANING WITH CLEANING AGENT AND WARM WATER. INCL.

JOB 6;

2/01/2020 Bas_1 = Basic 205380 km 0.70 H Version: .
Additional work: Turntable lubrication Duration: 0.2
Additional work: Contracts Plus extras Duration: 1
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

JOB 7;

Carry out Contracts Plus checks
=====
Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
BASIC MAINTENANCE
BASIC MAINTENANCE 3-5 axles
2/01/2020 Cen_1 = Centrifugal oil cleaner 205380 km 0.20 H Version: .
Maintenance, centrifugal oil cleaner.



	1769799	1 O-RING	ENG
	1769800	1 ORING	OIL CLEANER
	2153365	1 OIL FILTER	INSERT
JOB 8;		2/01/2020	Swu_1 = Software updates 205610 km 0.40 H Addition to maintenance. Software update
JOB 9;		2/01/2020	Bat_2 = Batteries 205610 km 0.30 H Version: . Batteries maintenance.,
JOB 10;		2/01/2020	Br_1 = brake test 205610 km 0.50 H Version: . Additional work: Annual Safety Inspection Duration: 0.1 Maintenance, brake test., 2-3 axles 2-3 axles
JOB 11;		2/01/2020	Ch_1 = Chassis 1 205610 km 0.60 H Version: . Maintenance, chassis 1., 3-4 axles 3-4 axles
JOB 12;		2/01/2020	Fue_1 = Fuel filter 207240 km 0.40 H Version: . Maintenance, fuel system. PDE
JOB 13;	1873018	1 FILTER	
		2/01/2020	Eng_1 = Engine 207240 km 0.50 H Version: . Fluid description: Engine oil LDF-3 Quantity: , 41 Maintenance, engine oil., DC09-DC16 DC09-DC16
	0750226	1 ORING	
	1328242	1 ORING	
	2625884	1 REP KIT	
	2419091	1 WASHER	
	2405798	46 LDF3	IBC
	2546263	0.5 ENGINE OIL	E7 15W-40 205L
JOB 14;	ENV	1 ENVIROMENT	LEVY
		2/01/2020	Cgr_1 = Chassis lubrication 207240 km 0.40 H Version: . Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4
JOB 15;		2/01/2020	Ch_2 = Chassis 2 230770 km 0.50 H Version: . Maintenance, chassis 2., 1 steering axle 1 steering axle
			SUNDRY ITEMS
			GST DEDUCTED!

51061046	51230154	9213645	SB81KT	PM126	284459	28 Jan 2020	20 Jan 2020	JOB 2;
51061046	51512291	9213645	SB81KT	PM126	284459	28 Jan 2020	20 Jan 2020	JOB 1;

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
F: Breakdown truck overheating
C: Blown hose and 4x failed coolant pipe mounts.
R: Travelled to vehicle. Replaced blown gearbox coolant hose and rubber mounts. Filled with coolant and pressure tested. Returned to workshop.
Package (1 times) 22002200 =====
Business hours callout. Includes mileage cost within 25km of Scania Australia workshop.
(Apples Mon - Fri 7.00am - 5.00pm except public holidays)

OSF 1 OFF SITE FEE

MILE

1876631
0816135
1388070

50 MILEAGE

=====

1 HOSE
2 HOSE CLAMP 50-70MM
4 RUBBER MOUNT
Group LABOUR -----
Pressure test cooling system on engine.
Renew coolant hose, 1 off, in cooling system. Incl. drain and fill coolant.
Renew insulator, 3 off, for coolant pipe on gearbox.

SUNDRY ITEMS

GST DEDUCTED!

F: DIAGNOSE AND REPORT - INCORRECT SPEEDO. SPEEDO SAYS 100 KMPH, BUT GPS SAYS 96 KMPH.

C: requested

R: Reset kilometer factor to suit.

Group LABOUR -----

Check speed limiter.

Test drive vehicle.

SUNDRY ITEMS

Repairs

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

DIAGNOSE AND REPAIR: AC NOT WORKING. Found leaking shroeder valve. Degassed. Removd and replaced valve, carried out a/c service. Regassed. Checked- all ok

Group LABOUR -----

RTA No AU07116 Exp 12.12.2021

1772730
1772728
1899517
1377373
1908345
1908346
1913500

1 DRYER
1 EXPANSION VALVE
1 O-RING
1 O-RING
1 O-RING
1 O-RING
1 O-RING
1 FILTER

SUNDRY ITEMS

GST DEDUCTED!

Repairs

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.

1 LDF3 5L

2405795

51061110 51230220 9213645 SB81KT PM126 284459 31 Jan 2020 22 Jan 2020 JOB 1;

51061308 51230468 9213645 SB81KT PM126 284459 28 Feb 2020 04 Feb 2020 JOB 2;

51061308 51512500 9213645 SB81KT PM126 284459 28 Feb 2020 04 Feb 2020 JOB 1;

51062709 51230963 9213645 SB81KT PM126 284459 29 Apr 2020 28 Apr 2020 JOB 8;

51062709 51512855 9213645 SB81KT PM126 284459 29 Apr 2020 28 Apr 2020 JOB 1;



JOB 2;

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

0189044
0219193

3 BULB 1134 24V 24W BA15S
2 BULB

JOB 3;

FIFTH WHEEL: Check for Wear & Function and Lubricate

Additional work: Turntable lubrication Duration: 0.2

Lubricate fifth wheel. Incl. check clearance, check wear.

Operation 19055026, previously performed on 2/01/2020 at site ADL, Dealer SCANIA, is related to work order 51060739. Previous mileage 201131

26/05/2020 Bas_1 = Basic 223410 km 0.70 H Version: .

Additional work: Contracts Plus extras Duration: 1

Package (1 times) 00168101 =====

Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.

Check and replace any blown fuses.

Check all fluids and top up where necessary.

Check and carry out any software updates if available.

Check all tyre pressures and inflate any under inflated tyres to correct pressure.

General non time consuming tasks.

Carry out Contracts Plus checks

=====

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1

FIRE EXT CHECK

BASIC MAINTENANCE

BASIC MAINTENANCE 3-5 axles

26/05/2020 Cgr_1 = Chassis lubrication 223410 km 0.60 H Version: .

Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4,

8x2*6 8x2/4

Maintenance, fifth wheel., Tractor Fifth wheel

26/05/2020 Annual Wheel Alignment 225510 km 2.00 H

Package 13008950 (1 times) =====MEASURE ALL WHEEL ANGLES AND ROLLING DIRECTION ON

ALL AXLES

Check and adjust all tyre pressures. Measure all wheel angles and rolling direction using computer

aided laser on all front and rear axles. Print report.

If alignment is out of specification, a failure report must be submitted. Package 13008951 must be

added to the job, to make adjustments.

Measure toe-in and rolling direction using computer-aided laser on twin front axles and rear axles.

Operation 13005127, previously performed on 4/06/2019 at site ADL, Dealer SCANIA, is related to

work order 51057409. Previous mileage 167340

=====

JOB 5;

JOB 6;



JOB 7;

Next inspection mileage: 245610

Replace broken muffler support bracket bolt. Found snapped bolt. Tapped out bolt, replaced bolt.
Checked- all ok

Group LABOUR -----
REPLACE MUFFLER MOUNT BOLTS

0815623

1 SCREW

0815135

1 NUT,M14 HEX

SUNDRY ITEMS

GST DEDUCTED!

Repairs

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

Diagnose and repair - RH mirror damaged (inside parts damaged). Repair as required. Found failed actuator. Removed mirror, replaced actuator. Checked- all ok

Group LABOUR -----
Renew swivel joint, 1 off, in exterior rear view mirror.

2659720

1 SWIVEL JOINT

SUNDRY ITEMS

GST DEDUCTED!

DIAGNOSE AND REPAIR: Door will not shut correctly, have to slam it

Cause Caught in wind

Remedy Re adjust door hinge best as possible next time will have to go to crash shop

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

DIAGNOSE AND REPAIR: When you take the hand brake off and have interior light switch on the horn goes off.

Cause no fault found

Remedy tested fault no fault found may have been related to job 2

DIAGNOSE AND REPAIR: Interior lights are not working. Wiring fault and blown globe. Replaced and repaired as required.

Renew cab lighting, 1 off, in roof.

1 BULB 1117 24V 20W BA15S

Replace wiper blades

Cause worn blades

Remedy Remove and replace worn blades

Renew wiper blade, 2 off.

1 WIPER BLADE SET

DIAGNOSE AND REPAIR: RH indicator near door not working.

Cause blown bulb

Remedy removed and replaced blown bulb

Renew bulb, 1 off, in direction indicator.

1 BULB 1134 24V 24W BA15S

SUNDRY ITEMS

GST DEDUCTED!

51062612 51231158 9213645 SB81KT PM126 0 20 May 2020 22 Apr 2020 JOB 2;

51062612 51512978 9213645 SB81KT PM126 0 20 May 2020 22 Apr 2020 JOB 1;

51063615 51231751 9213645 SB81KT PM126 284459 21 Jul 2020 22 Jun 2020 JOB 1;

JOB 3;

51063615 51513369 9213645 SB81KT PM126 284459 21 Jul 2020 22 Jun 2020 JOB 2;

JOB 4;

JOB 5;

0032774

2657198

0189044



1232144	9213645	SB81KT	PM126	239100	27 Aug 2020	25 Aug 2020	JOB 3;	ALL ITEMS TO BE REMOVED FROM CAB PRIOR TO SERVICE
513661	9213645	SB81KT	PM126	239100	27 Aug 2020	25 Aug 2020	JOB 1;	This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN
							JOB 2;	Top up with engine oil. 5 LDF3 IBC CHECK AND REFILL GLOBE BOX AT EVERY SERVICE
							JOB 4;	2405798 2 GLOBE H7 21/09/2020 Bas_1 = Basic 242300 km 0.70 H Version: . Package (1 times) 00168101 ===== Please check and replace/adjust the following items. Check and replace any bulbs that are not working. Check and replace any blown fuses. Check all fluids and top up where necessary. Check and carry out any software updates if available. Check all tyre pressures and inflate any under inflated tyres to correct pressure. General non time consuming tasks. Carry out Contracts Plus checks =====
							JOB 5;	Additional work: Turntable lubrication Duration: 0.2 Additional work: Contracts Plus extras Duration: 1 Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1 BASIC MAINTENANCE BASIC MAINTENANCE 3-5 axles 21/09/2020 Cgr_1 = Chassis lubrication 242300 km 0.60 H Version: . Maintenance, chassis lubrication., 6x2, 8x2, 6x4, 4x4, 6x2* 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4 Maintenance, fifth wheel., Tractor Fifth wheel
							JOB 6;	22/10/2020 Fue_1 = Fuel filter 247100 km 0.40 H Version: . Maintenance, fuel system. PDE
							JOB 7;	1873018 1 FILTER 22/10/2020 Cen_1 = Centrifugal oil cleaner 247100 km 0.20 H Version: . Maintenance, centrifugal oil cleaner.,
							JOB 8;	1769799 1 O-RING ENG 1769800 1 ORING OIL CLEANER 2153365 1 OIL FILTER INSERT 22/10/2020 Eng_1 = Engine 247100 km 0.50 H Version: . Fluid description: Engine oil LDF-3 Quantity: , 41 Maintenance, engine oil., DC09-DC16 DC09-DC16
								0750226 1 ORING 1328242 1 ORING



2625884
2419091

2405798
4095180
ENV

JOB 9;

1869993

1 REP KIT
1 WASHER
Next inspection mileage: 247100
45 LDF3 IBC
0.5 RENOLIT XTB2 GREASE 180KG (PRICE PER KG)
1 ENVIROMENT LEVY
air filter blocked - replace. Replaced blocked filter.
1 AIR FILTER
Renew air filter, 1 off, on engine.
SUNDRY ITEMS
GST DEDUCTED!

51065096 51232537 9213645 S881KT PM126 244265 08 Oct 2020 07 Oct 2020 JOB 3;

51065096 51513891 9213645 S881KT PM126 244265 08 Oct 2020 07 Oct 2020 JOB 1;

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
DIAGNOSE AND REPAIR: A/C HAS DROPPED OUT
Cause Compressor low pressure
Remedy Diagnosed low pressure in ac system traced for leaks, found tx valve faulty removed and replaced tx valve pressure tested system all good, filled with gas 1.235kgs and found ac works intermittantly removed and replaced AC Compressor road tested all good

Drain and fill refrigerant in climate system. Incl. remove and fit water valve, renew receiver dryer, renew pressure switch.

RTA No AU07116 Exp 12.12.2021
Renew 1 AC compressor.

0573125
1377374
1899517
1772730
1377373
1899517
1908346
1913500

RTA No AU07116 Exp 12.12.2021
1 A/C COMPRESSOR
1 O-RING
1 O-RING
1 DRYER
1 O-RING
1 O-RING
1 O-RING
1 FILTER

SUNDRY ITEMS
GST DEDUCTED!
CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

51066216 51233193 9213645 S881KT PM126 258025 21 Dec 2020 16 Dec 2020 JOB 2;

JOB 3;

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
ALL ITEMS TO BE REMOVED FROM CAB PRIOR TO SERVICE

066216 51514417 9213645 SB81KT PM126 258025 21 Dec 2020 16 Dec 2020

JOB 4;

"CARRY OUT AVI. THIS MUST INCLUDE:
 SCANIA UP TO RWC STANDARDS SHEET
 SERVICE SHEETS
 BRAKE TEST SHEET
 SPEED LIMITER SHEET
 THESE DOCUMENTS MUST BE NAMED CORRECTLY WHEN SCANNING THEM, SO THEY ARE
 UPLOADED TO THE PORTAL
 CORRECTLY"

JOB 1;

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

2405798

JOB 5;

Top up with engine oil.

5 LDF3 IBC

15/12/2020 Cgr_1 = Chassis lubrication 257210 km 0.60 H Version: .
 Maintenance, chassis lubrication.

JOB 7;

15/12/2020 Radiator & intercooler external clean 259780 km 0.90 H
 Additional work: Radiator & intercooler clean Duration: 0
 Package 020100009061 Radiator clean charge air cooler out ==
 EXTERNAL CLEANING WITH CLEANING AGENT AND WARM WATER. INCL.

JOB 9;

15/12/2020 Swu_1 = Software updates 259940 km 0.40 H Version: .
 Software update, maintenance.
 Operation 00225115, previously performed on 2/01/2020 at site ADL, Dealer SCANIA, is related to
 work order 51060739. Previous mileage 201131

JOB 10;

15/12/2020 Ch_1 = Chassis 1 259940 km 0.60 H Version: .
 Maintenance, chassis 1.

JOB 11;

15/12/2020 Br_1 = brake test 259940 km 0.50 H Version: .
 Maintenance, brake test.

JOB 12;

Additional work: Annual Safety Inspection Duration: 0.1
 15/12/2020 Bat_2 = Batteries, 24 V 259940 km 0.30 H Version: .
 Batteries maintenance.

JOB 13;

15/12/2020 Ai_1 = Air filter 260100 km 0.20 H Version: .
 Maintenance, air filter.

1869993

JOB 14;

1 AIR FILTER
 15/12/2020 Des_1 = Desiccant container 260100 km 0.20 H Version: .
 Dessicant container maintenance.

2562323

JOB 15;

1 FILTER
 15/12/2020 Fut_1 = Fuel tank 260100 km 0.20 H Version: .
 Maintenance on fuel tank.

2240905

JOB 16;

2 FILTER
 15/12/2020 Va_1 = Valve adjustment 260100 km 1.10 H Version: .
 Maintenance, valve clearance.

JOB 17;

15/12/2020 Clu_1 = Clutch fluid 260100 km 0.70 H Version: .
 Clutch fluid maintenance.

JOB 18;

15/12/2020 Ge_1 = Gearbox 263000 km 0.40 H Version: .
 Maintenance, gearbox oil.



										2002705 0349419	JOB 19;	Fluid description: Scania Gear oil 80W/140 Quantity: , 16.5 1 OIL FILTER G/BOX 2 O-RING ENG 15/12/2020 Ax_1 = Rear central gears 263000 km 0.70 H Version: . maintenance, maintenance Fluid description: Scania Gear oil 80W/140 Quantity: . 28 2 OIL FILTER G/BOX 4 WASHER 44 SCANIA GEAR OIL 0.5 RENOLIT XTB2 GREASE 180KG (PRICE PER KG) 1 ENVIROMENT LEVY 15/12/2020 Replace Batteries 273470 km 1.20 H Additional work: Batteries Duration: 0 Renew 1 or 2 batteries.
										2002705 2001228 2548888 4095180 ENV	JOB 20;	2 BATTERY 15/12/2020 Belts & pulleys (PDE engines) 273470 km 0.90 H Additional work: Belt & pulleys Duration: 0 Renew poly-V-belt, 1 off, in cooling system. Renew belt tensioner, 1 off, for poly-V-belt in cooling system. Renew idler roller, 1 off, for engine belt transmission.
										N150LEFB	JOB 21;	1 BELT TENSIONER 2 IDLER ROLLER 1 POLY-V-BEL SUNDRY ITEMS GST DEDUCTED!
										2197391 2129402 1920231		Repairs This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge REPAIR: EXHAUST PIPE EXTENSION ON THE BOTTOM OF THE MUFFLER HAS SNAPPED OFF. Removed and replaced silencer, pipe and nox sensor. Carried out devalidation and road test - all ok
51066524	51233562	9213645	SB81KT	PM126	260890	30 Jan 2021	20 Jan 2021				JOB 2;	Group LABOUR ----- NOX SENSOR CATALYTIC CONVERTOR Renew flexible hose, 1 off, in exhaust system. Renew silencer outlet, 1 off, for the exhaust system. Check SCR catalytic converter, 1 off, in exhaust system. Incl. use Scania Diagnos. Test drive vehicle.
51066524	51514703	9213645	SB81KT	PM126	260890	30 Jan 2021	20 Jan 2021				JOB 1;	1 3EXHAUST PI 1 V-CLAMP 1 SILENCER OUTLET 1 SENSOR - NOX SUNDRY ITEMS GST DEDUCTED!
51067772	51234174	9213645	SB81KT	PM126	277173	13 Apr 2021	13 Apr 2021				JOB 2;	CHECK AND REFILL GLOBE BOX AT EVERY SERVICE





1067772 51515201 9213645 S881KT PM126 277173 13 Apr 2021 13 Apr 2021 JOB 1;

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
ALL ITEMS TO BE REMOVED FROM CAB PRIOR TO SERVICE

CARRY OUT OIL TOP UP FOR SL BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.
Operation 01005149, previously performed on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025, on 25/08/2020 at site ADL, Dealer SCANIA, is related to work order 51064507. Previous mileage 239100, on 28/04/2020 at site ADL, Dealer SCANIA, is related to work order 51062709. Previous mileage 284459

JOB 4; 2405798

S LDF3 IBC
23/02/2021 Bas_1 = Basic 268600 km 0.70 H Version: .
Additional work: Contracts Plus extras Duration: 1
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

Carry out Contracts Plus checks
=====

JOB 5;

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Additional work: Turntable lubrication Duration: 0.2
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles
23/02/2021 Replace starter motor 277290 km 1.00 H
Additional work: Replace starter Duration: 0
Renew starter motor, 1 off. Incl. remove and fit noise shields, check function.

JOB 6; 0573548

1 STARTER MO
23/02/2021 Coolant pump & coolant 277290 km 2.40 H
Additional work: Coolant pump & coolant Duration: 0
Renew 1 coolant pump in cooling system. Incl. remove and fit poly-V-belts, renew seal.

JOB 7; 0576662

23/02/2021 Coo_1 = Coolant 277610 km 0.70 H Version: .
Ref Scania protocol Coolant Maint. DC09/DC16
1 COOLANT PUMP

JOB 8; 1886594

1 SEAL
23/02/2021 Cgr_1 = Chassis lubrication 278260 km 0.60 H Version: .
Ref Scania protocol Maint, chassis lubrication. 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4



JOB 9;
 2153365
 1769799
 1769800

JOB 10;
 0750226
 1328242
 2625884
 2419091
 2405798
 4095180
 ENV

JOB 11;
 1873018

JOB 12;
 2544995
 1852189

JOB 13;

Ref Scania protocol Maint, fifth wheel. Fifth wheel
 2/05/2021 Cen_1 = Centrifugal oil cleaner 279540 km 0.20 H Version: .
 Ref Scania protocol Maint, centrifugal oil cleaner.
 1 OIL FILTER INSERT
 1 O-RING ENG
 1 ORING OIL CLEANER
 2/05/2021 Eng_1 = Engine 279540 km 0.50 H Version: .
 Fluid description: Engine oil LDF-3 Quantity: , 41
 Ref Scania protocol Maint, engine oil. DC09-DC16
 1 ORING
 1 ORING
 1 REP KIT
 1 WASHER
 41 LDF3 IBC
 0.5 RENOLIT XTB2 GREASE 180KG (PRICE PER KG)
 1 ENVIROMENT LEVY
 2/05/2021 Fue_1 = Fuel filter 279540 km 0.40 H Version: .
 Ref Scania protocol Maint, fuel filter. PDE
 1 FILTER
 2/05/2021 Red_1 = Reductant filter 284700 km 0.30 H Version: .
 Ref Scania protocol Maint, SCR. Reductant filter With prefilter
 1 FILTER
 1 PREFILTER
 2/05/2021 Annual Wheel Alignment 285500 km 2.00 H
 Package 13008950 (1 times) =====MEASURE ALL WHEEL ANGLES AND ROLLING DIRECTION ON ALL AXLES
 Check and adjust all tyre pressures. Measure all wheel angles and rolling direction using computer aided laser on all front and rear axles. Print report.

If alignment is out of specification, a failure report must be submitted. Package 13008951 must be added to the job, to make adjustments.
 Measure toe-in and rolling direction using computer-aided laser on twin front axles and rear axles.

Operation 13005127, previously performed on 28/04/2020 at site ADL, Dealer SCANIA, is related to work order 51062709. Previous mileage 284459
 =====
 SUNDRY ITEMS
 GST DEDUCTED!
 Repairs
 This is an Information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
 CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.
 5 LDF3 IBC
 2 SCANIA PRE MIX COOLANT (205L DRUM)

069467	51235243	9213645	SB81KT	PM126	297682	28 Jul 2021	27 Jul 2021	JOB 6;
069467	51516102	9213645	SB81KT	PM126	297682	28 Jul 2021	27 Jul 2021	JOB 1;



5040180

0.5 L-LX/CA 700 EP2 GREASE (180KG - PRICED PER KG)

Operation 01005149, previously performed on 13/04/2021 at site ADL, Dealer SCANIA, is related to work order 51067772. Previous mileage 277173, on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025, on 25/08/2020 at site ADL, Dealer SCANIA, is related to work order 51064507. Previous mileage 239100

JOB 2;

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

JOB 3;

ALL ITEMS TO BE REMOVED FROM CAB PRIOR TO SERVICE

JOB 4;

5/08/2021 Cgr_1 = Chassis lubrication 300120 km 0.60 H Version: .
Ref Scania protocol Maint, chassis lubrication. 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4

JOB 5;

Ref Scania protocol Maint, fifth wheel. Fifth wheel
5/08/2021 Bas_1 = Basic 300120 km 0.70 H Version: .
Additional work: Turntable lubrication Duration: 0.2
Lubricate fifth wheel. Incl. check clearance, check wear.
Additional work: Contracts Plus extras Duration: 1
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

Carry out Contracts Plus checks

=====
Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles
Next inspection mileage: 323000
Renew air filter, 1 off, on engine.
Operation 01455015, previously performed on 25/08/2020 at site ADL, Dealer SCANIA, is related to work order 51064507. Previous mileage 239100

1869993

1 AIR FILTER

SUNDRY ITEMS
GST DEDUCTED!

1070821	51236296	9213645	SB81KT	PM126	316726	25 Oct 2021	20 Oct 2021	JOB 3;
51070821	51516851	9213645	SB81KT	PM126	316726	25 Oct 2021	20 Oct 2021	JOB 1;

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
Diagnose/report: Truck losing air. Cause: Air tap is broken inside, at the bottom of the back of the truck. Cause: Internal failure of emergency trailer tap. Fould faulty valve. Removed and fit new.
Tested, all OK.



Group LABOUR -----
Fit trailer tap

JOB 2; 1424404

1 VALVE
Repair: Top up oil
Group LABOUR -----
Top up with engine oil.

2405798

8 LDF3 IBC
SUNDRY ITEMS
GST DEDUCTED!

51070963 51236369 9213645 SB81KT PM126 319294 01 Nov 2021 01 Nov 2021 JOB 17;

JOB 1;

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
Next inspection mileage: 339790
CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.
Operation 01005149, previously performed on 20/10/2021 at site ADL, Dealer SCANIA, is related to work order 51070821. Previous mileage 316726, on 27/07/2021 at site ADL, Dealer SCANIA, is related to work order 51069467. Previous mileage 297682, on 13/04/2021 at site ADL, Dealer SCANIA, is related to work order 51067772. Previous mileage 277173, on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025

SCA, DTCL094, DTLC094 - Qube cab and chassis mounted grab handles

Please refer to campaign letter for instructions.

JOB 2;

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

JOB 3;

ALL ITEMS TO BE REMOVED FROM CAB PRIOR TO SERVICE

JOB 4;

"CARRY OUT AVI. THIS MUST INCLUDE:
SCANIA UP TO RWC STANDARDS SHEET
NHVR CHECKLIST
SERVICE SHEETS
BRAKE TEST SHEET
SPEED LIMITER SHEET
THESE DOCUMENTS MUST BE NAMED CORRECTLY WHEN SCANNING THEM, SO THEY ARE
UPLOADED TO THE PORTAL CORRECTLY
"

JOB 5;

LOBETHAL PICKUP AND DROP OFF

SUNDRY ITEMS



0963 51516919 9213645 S881KT PM126 319294 01 Nov 2021 01 Nov 2021 JOB 6;

29/09/2021 Bas_1 = Basic 311134 km 0.70 H Version: .
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

- Check and replace any bulbs that are not working.
- Check and replace any blown fuses.
- Check all fluids and top up where necessary.
- Check and carry out any software updates if available.
- Check all tyre pressures and inflate any under inflated tyres to correct pressure.
- General non time consuming tasks.

0189044
1 BULB 1134 24V 24W BA15S

Carry out Contracts Plus checks
=====

Additional work: Turntable lubrication Duration: 0.2
Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Additional work: Contracts Plus extras Duration: 1
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles

JOB 7;

1893214
1 RETARDER INSPECTION KIT

29/09/2021 Ret_1 = Retarder 311134 km 0.30 H Version: .
Fluid description: ATF Dexron III Quantity: , 7.7
Ref Scania protocol Maint, retarder oil. Retarder

JOB 8;

JOB 9;
2153365
1769799
1769800
1 OIL FILTER INSERT
1 O-RING ENG
1 ORING OIL CLEANER

Ref Scania protocol Maint, fifth wheel. Fifth wheel
12/11/2021 Cen_1 = Centrifugal oil cleaner 318960 km 0.20 H Version: .
Ref Scania protocol Maint, centrifugal oil cleaner.

JOB 10;

1873018
JOB 11;
0750226
1328242
2625884
2419091
5040180
2546263
ENV

12/11/2021 Fue_1 = Fuel filter 318960 km 0.40 H Version: .
Ref Scania protocol Maint, fuel filter. PDE
1 FILTER
12/11/2021 Eng_1 = Engine 318960 km 0.50 H Version: .
Fluid description: Engine oil LDF-3 Quantity: , 41
Ref Scania protocol Maint, engine oil. DC09-DC16

- 1 ORING
- 1 ORING
- 1 REP KIT
- 1 WASHER
- 0.5 L-LX/CA 700 EP2 GREASE (180KG - PRICED PER KG)
- 7.7 ENGINE OIL E7 15W-40 205L
- 1 ENVIROMENT LEVY



300012933
1921957

JOB 12;

JOB 13;

JOB 14;

JOB 15;

JOB 16;

41 RIMULA ULTRA SW30 (209L - PRICED PER LITRE)

1 SCANIA PRE MIX COOLANT (205L DRUM)

12/11/2021 Radiator & intercooler external clean 324840 km 0.90 H

Additional work: Radiator & intercooler clean Duration: 0

Clean 2 radiators for engine. Incl. clean charge air cooler.

Operation 02015088, previously performed on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025

12/11/2021 Bat_2 = Batteries, 24 V 325010 km 0.30 H Version: .

Ref Scania protocol Batteries Maint.

12/11/2021 Swu_1 = Software updates 325010 km 0.40 H Version: .

Ref Scania protocol Software update, Maint. Software update

12/11/2021 Ch_1 = Chassis 1 325010 km 0.60 H Version: .

Ref Scania protocol Maint, chassis 1. 3-4 axles

12/11/2021 Br_1 = brake test 325010 km 0.50 H Version: .

Additional work: Annual Safety Inspection Duration: 0.1

Ref Scania protocol Maint, brake test. 2-3 axles

SUNDRY ITEMS

GST DEDUCTED!

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.

Operation 01005149, previously performed on 20/10/2021 at site ADL, Dealer SCANIA, is related to work order 51070821. Previous mileage 316726, on 27/07/2021 at site ADL, Dealer SCANIA, is related to work order 51069467. Previous mileage 297682, on 13/04/2021 at site ADL, Dealer SCANIA, is related to work order 51067772. Previous mileage 277173, on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025

SCA, DTCL094, DTLC094 - Qube cab and chassis mounted grab handles

Please refer to campaign letter for instructions.

SUNDRY ITEMS

GST DEDUCTED!

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.

Operation 01005149, previously performed on 20/10/2021 at site ADL, Dealer SCANIA, is related to work order 51070821. Previous mileage 316726, on 27/07/2021 at site ADL, Dealer SCANIA, is related to work order 51069467. Previous mileage 297682, on 13/04/2021 at site ADL, Dealer SCANIA, is related to work order 51067772. Previous mileage 277173, on 16/12/2020 at site ADL, Dealer SCANIA, is related to work order 51066216. Previous mileage 258025

51070963 51516922 9213645 SB81KT PM126 319294 01 Nov 2021 01 Nov 2021 JOB 1;

51070963 51907446 9213645 SB81KT PM126 319294 01 Nov 2021 01 Nov 2021 JOB 1;



SCA, DTCL094, DTLC094 - Qube cab and chassis mounted grab handles

Please refer to campaign letter for instructions.

Invoice No	Job No	Part No	Part Name	Part Desc	Qty	Unit	Invoice Date	Job Date	Job Description	Part No	Part Name	Part Desc	Qty	Unit	Job Description
1071131	51236533	9213645	S881KT	PM126	322498	18 Nov 2021	16 Nov 2021	JOB 3;	Repair						
									This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge						
1071131	51517053	9213645	S881KT	PM126	322498	18 Nov 2021	16 Nov 2021	JOB 1;	Diagnose and report: Drivers window will not raise. Cause: Broken window winder mechanism. Removed door panels and removed window mechanism. Held window up and carried out temporary repair as nil parts in stock. Ordered parts. Additional time required to disconnect and reconnect trailer.						
									Group LABOUR -----						
									Renew 1 door window. Incl. remove and fit inner door panel, remove and fit electric window motor and adjust lowest position.						
									Connect vehicle, 1 off, trailer.						
									Free text for door						

									2572351						
									1346119						
									JOB 2;						
									1 WINDER						
									1 GLIDER						
									Diagnose/report: Drivers door doesnt open sometimes from inside. Cause: Broken cable. Diagnosed and found broken cable for handle/latch release. Replaced wire as required.						
									Group LABOUR -----						
									Renew wire rope, 1, between inner door handle and door lock						
									Measure and adjust 1 door lock.						

									1498712						
									1 WIRE						
									SUNDRY ITEMS						
									GST DEDUCTED!						
51072578	51517797	9213645	S881KT	PM126	349228	23 Feb 2022	22 Feb 2022	JOB 1;	CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN						
									Top up with engine oil.						
									2405798						
									JOB 3;						
									5 LDF3 IBC						
									12/03/2022 Eng_1 = Engine 349180 km 0.50 H Version: .						
									Fluid description: Engine oil LDF-3 Quantity: , 41						
									Ref Scania protocol Maint, engine oil. DC09-DC16						
									0750226						
									1 ORING						
									1328242						
									1 ORING						
									2625884						
									1 REP KIT						
									2419091						
									1 WASHER						
									2405798						
									41 LDF3 IBC						
									5040180						
									0.5 L-LX/CA 700 EP2 GREASE (180KG - PRICED PER KG)						
									ENV						
									JOB 4;						
									1 ENVIROMENT LEVY						
									12/03/2022 Cen_1 = Centrifugal oil cleaner 349180 km 0.20 H Version: .						



2153365
1769799
1769800
JOB 5;

Ref Scania protocol Maint, centrifugal oil cleaner.
1 OIL FILTER INSERT
1 O-RING ENG
1 ORING OIL CLEANER
12/03/2022 Bas_1 = Basic 349180 km 0.70 H Version: .
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

0032774

Carry out Contracts Plus checks
1 BULB 1117 24V 20W BA15S
=====

Additional work: Contracts Plus extras Duration: 1
Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Additional work: Turntable lubrication Duration: 0.2
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles
SUNDRY ITEMS
GST DEDUCTED!
CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

LOBETHAL PICKUP AND DROP OFF

"CARRY OUT AVI. THIS MUST INCLUDE:
SCANIA UP TO RWC STANDARDS SHEET
NHVR CHECKLIST
SERVICE SHEETS
BRAKE TEST SHEET
SPEED LIMITER SHEET
THESE DOCUMENTS MUST BE NAMED CORRECTLY WHEN SCANNING THEM, SO THEY ARE
UPLOADED TO THE PORTAL CORRECTLY
"

JOB 8;

AVI TO BE DONE AT BRANCH COST DUE TO BRANCH NOT PERFORMING BRAKE TEST AT LAST AVI

JOB 9;

Repairs

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge.
This was the last inspection for the plan.

51072578 51237563 9213645 SB81KT PM126 349228 25 Feb 2022 22 Feb 2022 JOB 2;

JOB 5;

JOB 7;



72578 51517806 9213645 SB81KT PM126 349228 25 Feb 2022 22 Feb 2022 JOB 11;

Add On - Found on service: Replace Broken RHS wide angle mirror assy

CAUSE: CRACKED
REMEDY: REPLACED AS REQUIRED
Group LABOUR -----
Renew mirror glass, 1 off, on external rear view mirror.

JOB 12; 1765810

1 WIDE-ANGLE MIRROR
Add On - found on service: Replace stretched scr tank band clamp

CAUSE: STRETCHED
REMEDY: REPLACED AS REQUIRED
Group LABOUR -----
Renew 1 fuel tank with 2 brackets. Incl. remove and fit fuel pick-up unit.

JOB 13; 1725896

1 STRAP
Add On - Found on service : Replace broken exhaust mount bolt

CAUSE: DAMAGED
REMEDY: REPLACED AS REQUIRED
Group LABOUR -----
Renew 1-2 V-clamps for exhaust system.

1940258

1 PRESS SCREW
SUNDRY ITEMS
GST DEDUCTED!

51073270 51238229 9213645 SB81KT PM126 362679 28 Apr 2022 07 Apr 2022 JOB 2;

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
LOBETHAL PICKUP AND DROP OFF

JOB 3;

51073270 51518296 9213645 SB81KT PM126 362679 28 Apr 2022 07 Apr 2022 JOB 1;

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

Top up with engine oil.
Operation 01005149, previously performed on 22/02/2022 at site ADL, Dealer SCANIA, is related to work order 51072578. Previous mileage 349228, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 20/10/2021 at site ADL, Dealer SCANIA, is related to work order 51070821. Previous mileage 316726, on 27/07/2021 at site ADL, Dealer SCANIA, is related to work order 51069467. Previous mileage 297682

JOB 4; 2405798

5 LDF3 IBC
8/04/2022 Cgr_1 = Chassis lubrication 360160 km 0.60 H Version: .



JOB 5;

Ref Scania protocol Maint, chassis lubrication. 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4

Ref Scania protocol Maint, fifth wheel. Fifth wheel
8/04/2022 Bas_1 = Basic 360160 km 0.70 H Version: .
Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Additional work: Contracts Plus extras Duration: 1
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

Carry out Contracts Plus checks

=====

Additional work: Turntable lubrication Duration: 0.2
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles
8/04/2022 Fue_1 = Fuel filter 360160 km 0.40 H Version: .
Ref Scania protocol Maint, fuel filter. PDE

JOB 6;

1873018

1 FILTER
SUNDRY ITEMS
GST DEDUCTED!

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
Breakdown - Rectify vehicle cruching gear. Travelled to vehicle, suspect internal fault in planetary gear. VEHICLE RECOVERED TO WORKSHOP, DIAGNOSE GEARBOX FAULT. Diagnosed, found planetary gear failed internally. Found s/e as cheapest repair option. Removed and replaced as required. Filled with oils. Carried out road test - all ok

Fixed price package (1 times) 22002203 BUSINESS HOURS CALLOUT
Travel to vehicle/engine. Scania Assistance for repair work on customer's premises.

=====

Business Hours workshop call out

51073675	51238792	9213645	SB81KT	PM126	376575	26 Jun 2022	10 May 2022	JOB 2;
51073675	51518732	9213645	SB81KT	PM126	376575	26 Jun 2022	10 May 2022	JOB 1;

Applies to:
Mon - Fri between 7.00am and 6.00pm except public holidays

Includes:
Mileage within 25 klms of Scania workshop and call out fee included

Additional Charges:
Mileage costs over 25klms applicable
Parts, fluids and consumables used for the repair
Travel time to/from repair and Repair time
Towing and recover charges if applicable

Travel From: _____ (start location)

Breakdown Destination: _____

Odometer Reading from: _____ To: _____

Registration No. of van used: _____

Group LABOUR -----

Troubleshoot individual product. Incl. starting or test driving in order to note fault symptoms.

Remove and fit planetary gear on gearbox with retarder. Incl. remove and fit retarder, change gearbox oil, use Scania Diagnos.
Test drive vehicle.

RECOVER TO WORKSHOP

0576443
2381008
1525270
1766023
1502384
1725236
1534318
1896694
2301052
1491382
1784973
1527384
2025757
2157511
2108947
183607
183608

1 PLANETARY
1 REP KIT
1 GASKET
1 GASKET
1 SEAL RING
8 BOLT
1 ROLLER BEARING
2 ORING
1 O-RING
1 GASKET
1 SHAFT SEAL
2 SENSOR UNIT
1 SEALING RING
1 SCREW
1 SEAL
1 SPACER
1 3MM BLACK NEOPRENE WASHER WITH STICKY BACK



									0182930	1 O RING
									0304426	1 O-RING
									1388070	3 RUBBER MOUNT
									0394156	3 O RING
									2002705	1 OIL FILTER G/BOX
									0816135	2 HOSE CLAMP 50-70MM
									2507616	1 HOSE
										SUNDRY ITEMS
										GST DEDUCTED!
51074631	51239037	9213645	SB81KT	PM126	380913	13 Jul 2022	11 Jul 2022	JOB 1;		CHECK AND REFILL GLOBE BOX AT EVERY SERVICE
								JOB 3;		LOBETHAL PICKUP AND DROP OFF
								JOB 10;		found on service turntable top worn. Removed and replaced as required. Checked- all ok
										Group LABOUR -----
										Remove and fit 1 fifth wheel.

									JSK37CZ	1 JSK37CZ TURNTABLE TOP
									4095450	1 RENOLIT XT B2 GREASE 450G
										SUNDRY ITEMS
51074631	51518876	9213645	SB81KT	PM126	380913	13 Jul 2022	11 Jul 2022	JOB 2;		CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN
										Top up with engine oil.
										Operation 01005149, previously performed on 7/04/2022 at site ADL, Dealer SCANIA, is related to work order 51073270. Previous mileage 362679, on 22/02/2022 at site ADL, Dealer SCANIA, is related to work order 51072578. Previous mileage 349228, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294, on 20/10/2021 at site ADL, Dealer SCANIA, is related to work order 51070821. Previous mileage 316726, on 27/07/2021 at site ADL, Dealer SCANIA, is related to work order 51069467. Previous mileage 297682
									2405798	5 LDF3 IBC
								JOB 5;		30/06/2022 Cen_1 = Centrifugal oil cleaner 379120 km 0.20 H Version: . Ref Scania protocol Maint, centrifugal oil cleaner.
									2153365	1 OIL FILTER INSERT
									1769799	1 O-RING ENG
									1769800	1 ORING OIL CLEANER
								JOB 6;		30/06/2022 Eng_1 = Engine 379120 km 0.50 H Version: . Fluid description: Engine oil LDF-3 Quantity: , 41 Ref Scania protocol Maint, engine oil. DC09-DC16
									0750226	1 ORING
									1328242	1 ORING
									2625884	1 REP KIT
									2419091	1 WASHER



JOB 7;

30/06/2022 Bas_1 = Basic 379120 km 0.70 H Version: .
Additional work: Turntable lubrication Duration: 0.2
Additional work: Contracts Plus extras Duration: 1
Package (1 times) 00168101 =====
Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.
Check and replace any blown fuses.
Check all fluids and top up where necessary.
Check and carry out any software updates if available.
Check all tyre pressures and inflate any under inflated tyres to correct pressure.
General non time consuming tasks.

Carry out Contracts Plus checks

=====

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1
Ref Scania protocol Basic Maint.
Ref Scania protocol Basic Maint. 3-5 axles
This was the last inspection for the plan.

JOB 8; 0294386

1 LUBRICATOR
Found on service airbags leaking. Removed and replaced 4x perished airbags. Checked- all ok

Group LABOUR -----
Renew air bellows, 2 off, on rear axle or tag axle with air suspension.

JOB 9; 1903608

4 AIR SPRING
found on service seatbelt frayed. Removed and replaced worn seat belt. Checked- all ok

2110968

Renew safety belt, 1 off.

1 SEAT BELT
SUNDRY ITEMS
GST DEDUCTED!

1074807	51239090	9213645	SB81KT	PM126	376575	19 Jul 2022	06 May 2022	JOB 1;
1074807	51518911	9213645	SB81KT	PM126	376575	19 Jul 2022	06 May 2022	JOB 2;
51074659	51239249	9213645	SB81KT	PM126	383256	28 Jul 2022	12 Jul 2022	JOB 2;
51074659	51519035	9213645	SB81KT	PM126	383256	28 Jul 2022	12 Jul 2022	JOB 1;

MAX24D

Max24 Refund for 3 days @ \$500 per day - *max24 reference Q1465*
-1500 MAX24 DISTRIBUTOR

MAX24D

Max24 Refund for 3 days @ \$500 per day - *max24 reference Q1465*
1500 MAX24 DISTRIBUTOR
GST DEDUCTED!

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge
DIAGNOSE/REPORT: Trailer Lights not working. Found blown fuse and rubbed through wiring.
Repaired wiring, and replaced fuse. Checked - all ok
Group LABOUR -----
DIAGNOSE/RECTIFY WIRING FAULT

SUNDRY ITEMS



GST DEDUCTED!

Repairs
This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

F: Breakdown - air bag
C: Blown air bag.
R: Attended breakdown. Removed and replaced right hand side air bag. Tested all OK
Fixed price package (1 times) 22002203 BUSINESS HOURS CALLOUT

1 BREAKDOWN BH
=====

Business Hours workshop call out
Applies to:
Mon - Fri between 7.00am and 6.00pm except public holidays

Includes:
Mileage within 25 klms of Scania workshop and call out fee included

Additional Charges:
Mileage costs over 25klms applicable
Parts, fluids and consumables used for the repair
Travel time to/from repair and Repair time
Towing and recover charges if applicable

Travel From: Gregor Rd, Reeves Plains.

Breakdown Destination: 14 Cypress Terrace, Murray Bridge

Odometer Reading from: 305,240 km To: 305,426 km (186 km)

Registration No. of van used: S358BNV
1 AIR SPRING

1 JOINT UNION
Group LABOUR -----
Travel to vehicle/engine. Scania Assistance for repair work on customer's premises.
Renew insert union, 1 off, for air suspension.
Renew 1 air bellows on rear axle or tag axle with air suspension.

136 MILEAGE
Travel to vehicle/engine. Scania Assistance for repair work on customer's premises.

SUNDRY ITEMS
GST DEDUCTED!

Repairs
Next inspection mileage: 410240

51074876 51239290 9213645 SB81KT PM126 383256 30 Jul 2022 25 Jul 2022 JOB 2;

51074876 51519071 9213645 SB81KT PM126 383256 30 Jul 2022 25 Jul 2022 JOB 1;

OSFBH

1903608

2058224

MILE

51075251 51239570 9213645 SB81KT PM126 387856 24 Aug 2022 23 Aug 2022 JOB 1;



51075251 51519279 9213645 SB81KT PM126 387856 24 Aug 2022 23 Aug 2022 JOB 2;

This is an information invoice only to advise the repairs requested by you and/or found by our workshop and were carried out on your vehicle at no charge

31/07/2022 Ge_1 = Gearbox 385290 km 0.40 H Version: .

Fluid description: Scania Gear oil 80W/140 Quantity: , 16.5

Ref Scania protocol Maint, Opticruise

Ref Scania protocol Maint, gearbox oil. Manual

2002705

1 OIL FILTER G/BOX

0349419

2 O-RING ENG

JOB 3;

31/07/2022 Ax_1 = Rear central gears 385290 km 0.70 H Version: .

Fluid description: Scania Gear oil 80W/140 Quantity: , 28

Ref Scania protocol Maint, Maint Rear axles 6x4, 6x6, 8x4, 8x6, 8x8, 8x4*4, 8x4/4, 8x6/4, 10x4*6, 10x4/6

2002705

1 OIL FILTER G/BOX

2002705

1 OIL FILTER G/BOX

2001228

2 WASHER

2001228

2 WASHER

JOB 4;

31/07/2022 Bas_1 = Basic 385290 km 0.70 H Version: .

Additional work: Contracts Plus extras Duration: 1

Package (1 times) 00168101 =====

Please check and replace/adjust the following items.

Check and replace any bulbs that are not working.

Check and replace any blown fuses.

Check all fluids and top up where necessary.

Check and carry out any software updates if available.

Check all tyre pressures and inflate any under inflated tyres to correct pressure.

General non time consuming tasks.

Carry out Contracts Plus checks

=====

Additional work: Fire Extinguisher Check & Record Date from Tag Duration: 0.1

Additional work: Turntable lubrication Duration: 0.2

Ref Scania protocol Basic Maint.

Ref Scania protocol Basic Maint. 3-5 axles

JOB 5;

31/07/2022 Cgr_1 = Chassis lubrication 393440 km 0.60 H Version: .

Ref Scania protocol Maint, chassis lubrication. 6x2, 8x2, 6x4, 4x4, 6x2*4, 6x2/4, 6x2*4, 8x2*6 8x2/4

Ref Scania protocol Maint, fifth wheel. Fifth wheel

JOB 6;

31/07/2022 Fue_1 = Fuel filter 393440 km 0.40 H Version: .

Ref Scania protocol Maint, fuel filter. PDE

1873018

1 FILTER

JOB 7;

31/07/2022 Red_1 = Reductant filter 397150 km 0.30 H Version: .

Ref Scania protocol Maint, SCR. Reductant filter With prefilter

2544995

1 FILTER

1852189

1 PREFILTER

JOB 8;

31/07/2022 A/C Service 401600 km 1.90 H



Drain and fill refrigerant in climate system. Incl. remove and fit water valve, renew receiver dryer, renew pressure switch.

RTA No AU07116 Exp 12.12.2024

Additional work: A/C service Duration: 0

1 EXPANSION VALVE

1 DRYER

1 FILTER

1 O-RING

1 O-RING

1 O-RING

1 O-RING

111 A/C GAS

1772728
1772730
1913500
1377373
1899517
1908345
1908346
MINOR1
JOB 9;

31/07/2022 Radiator & intercooler external clean 408020 km 0.90 H
Clean 2 radiators for engine. Incl. clean charge air cooler.

Operation 02015088, previously performed on 1/11/2021 at site ADL, Dealer SCANIA, is related to work order 51070963. Previous mileage 319294

Additional work: Radiator & intercooler clean Duration: 0

2 3SCANIA PRE MIX COOLANT (205L DRUM)

31/07/2022 Swu_1 = Software updates 408260 km 0.40 H Version: .

Ref Scania protocol Software update, Maint. Software update

31/07/2022 Br_1 = brake test 408260 km 0.50 H Version: .

Additional work: Annual Safety Inspection Duration: 0.1

Additional work: Speed Limiter Certificate Duration: 0.2

Ref Scania protocol Maint, brake test. 2-3 axles

31/07/2022 Ch_1 = Chassis 1 408260 km 0.60 H Version: .

Ref Scania protocol Maint, chassis 1. 3-4 axles

31/07/2022 Bat_2 = Batteries, 24 V 408260 km 0.30 H Version: .

Ref Scania protocol Batteries Maint.

"CARRY OUT AVI. THIS MUST INCLUDE:

SCANIA UP TO RWC STANDARDS SHEET

NHVR CHECKLIST

SERVICE SHEETS

BRAKE TEST SHEET

SPEED LIMITER SHEET

THESE DOCUMENTS MUST BE NAMED CORRECTLY WHEN SCANNING THEM, SO THEY ARE UPLOADED TO THE PORTAL CORRECTLY"

1921957
JOB 10;
JOB 11;
JOB 12;
JOB 13;
JOB 14;

JOB 15;

2267555

CHECK AND REFILL GLOBE BOX AT EVERY SERVICE

CARRY OUT OIL TOP UP FOR 5L BLACK SCANIA OIL BOTTLE INSIDE CABIN

1 BULB KIT H7

SUNDRY ITEMS

GST DEDUCTED!

